



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: DANCING_CLOUD_CT Cross Street: RADIANCE_LN Location: NE

ADA ID: RPRK211019181110 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 22

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

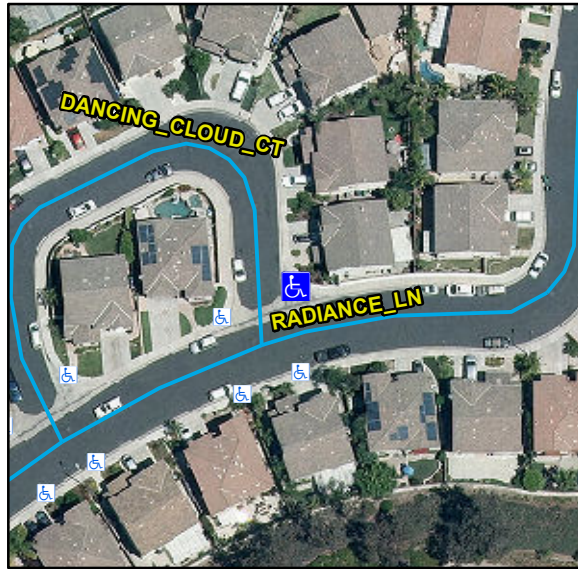

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, STD 1115

Total Cost: \$ 4150

Parcel ID Number	780-202-15	Street 1 Name	DANCING_CLOUD_CT
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	RADIANCE_LN
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58355491,-117.62583116

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	112	N/A	Ramp Length RT (in)	116
Yes	Ramp Width LT (in)	48	Yes	Ramp Width RT (in)	48
Yes	Ramp Run Slope LT (%)	4.5	Yes	Ramp Run Slope RT (%)	0.2
No	Ramp Cross Slope LT (%)	2.3	No	Ramp Cross Slope RT (%)	4.1
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.5		Crossing 2 Slope (%)	2.5
	Crossing 1 Cross Slope (%)	4.3		Crossing 2 Cross Slope (%)	0.6
Yes	Gutter Ponding	No	Yes	Curb Slope	3.4
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	0.5
Yes	Gutter Run Slope (%)	5		Road Cross Slope (%)	5.6
Yes	Gutter Cross Slope (%)	1.2	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

