



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CHANTILLY_LN		Cross Street: BENJAMIN_DR		Location: S
----------------------------------	--	----------------------------------	--	--------------------

ADA ID: RPRK211020155056	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 2
---------------------------------	-------------------------------------	--------------------------------	-------------------------------	--------------------------

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.5.3, STD 1115


Total Cost: \$ **8000**

Parcel ID Number	759-192-81	Street 1 Name	CHANTILLY_LN
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	BENJAMIN_DR
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.573938,-117.6373018

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

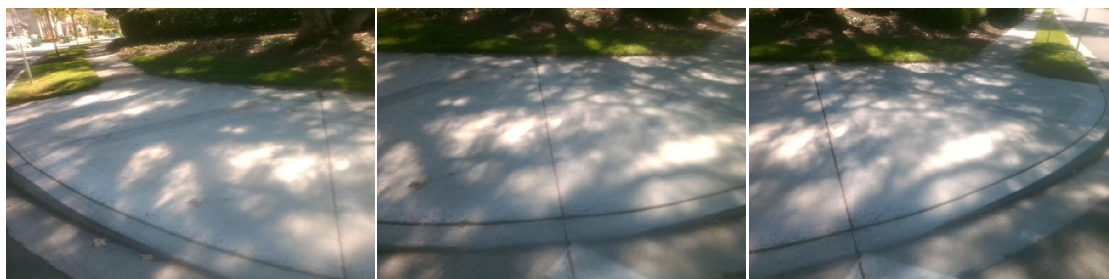

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	89	N/A	Ramp Length RT (in)	102
Yes	Ramp Width LT (in)	133	Yes	Ramp Width RT (in)	131
Yes	Ramp Run Slope LT (%)	8.1	Yes	Ramp Run Slope RT (%)	3.7
Yes	Ramp Cross Slope LT (%)	1.1	No	Ramp Cross Slope RT (%)	4.3
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	No
	Crossing 1 Slope (%)	6.3		Crossing 2 Slope (%)	4.3
	Crossing 1 Cross Slope (%)	2.5		Crossing 2 Cross Slope (%)	0.2
N/A	Gutter Ponding	N/A	No	Curb Slope	20
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.4
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	9.8
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A