



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ARTISAN_ST **Cross Street:** WYETH_ST **Location:** W

ADA ID: RPRK211020164611 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

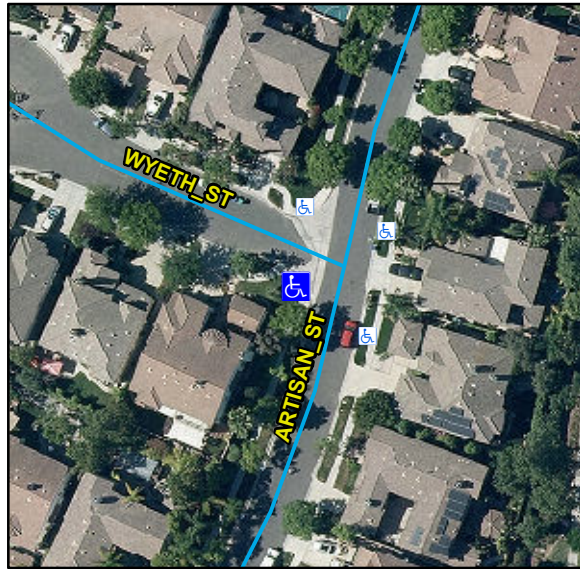

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R204.3, R304.3.2, STD 1115

Total Cost: \$ 4000

Parcel ID Number: 759-201-78
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.57176267,-117.63930737

Street 1 Name: ARTISAN_ST
Stop Condition-Street 1: NoControl
Street 2 Name: WYETH_ST
Stop Condition-Street 2: NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	108	N/A	Ramp Length RT (in)	114
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	5.7	No	Ramp Run Slope RT (%)	10.1
Yes	Ramp Cross Slope LT (%)	0.9	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.3		Crossing 2 Slope (%)	0.4
	Crossing 1 Cross Slope (%)	1.4		Crossing 2 Cross Slope (%)	1
N/A	Gutter Ponding	N/A	N/A	Curb Slope	2.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.9
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable		Spandrel Present?	Yes
	Cross Gutter Present?	Yes		Replace Spandrel?	No
	Replace Cross Gutter?	No			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

