



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **OSO_PKWY** Cross Street: **LOS_PATRONES_PKWY** Location: **NW**

ADA ID: **RPRK211021115302** Ramp Type: **Type 1 - Perpendicular Diagonal** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

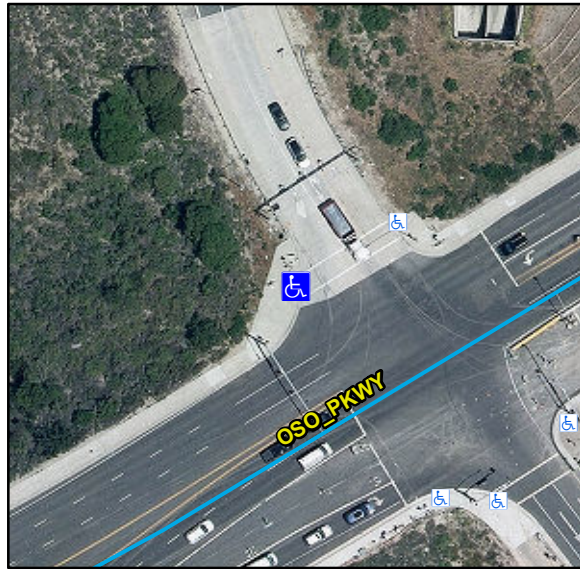

Possible Solutions:

Remove & Replace Curb Slope.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115

Total Cost: \$ **252**

Parcel ID Number **125-099-90**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58688629,-117.61127981

Street 1 Name **OSO_PKWY**
Stop Condition-Street 1 **Signal**
Street 2 Name **LOS_PATRONES_PKWY**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	109	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	6.5	Yes	Flare Slope LT (%)	6.3
Yes	Ramp Cross Slope (%)	0.7	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	91			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	8.5
Yes	Landing Run Slope (%)	0.4	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.9	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	0
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.5		Crossing 2 Slope (%)	4.6
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	1.7
Yes	Gutter Ponding	No	No	Curb Slope	14.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.9
Yes	Gutter Run Slope (%)	3.5		Road Cross Slope (%)	4.1
Yes	Gutter Cross Slope (%)	0.1			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	Yes
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

