




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LOS PATRONES PKWY	Cross Street: OSO PKWY	Location: NE
--------------------------------	------------------------	--------------

ADA ID: RPRK211021120833	Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 6
--------------------------	--	------------------------	-------------------

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

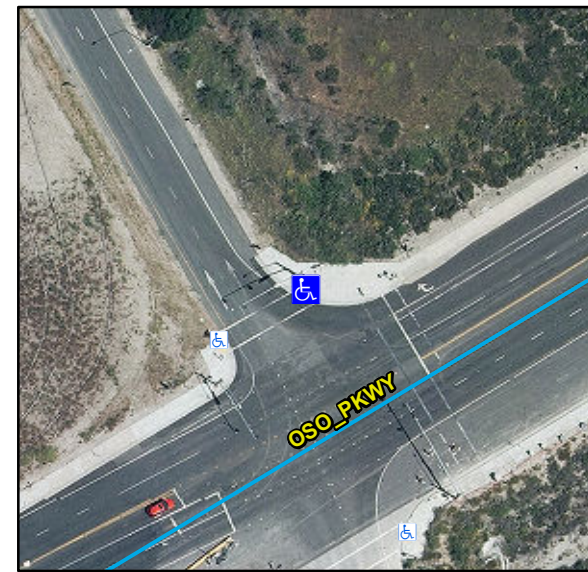

Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.4, STD 1115

Total Cost: \$ 252

Parcel ID Number	125-099-02	Street 1 Name	LOS PATRONES PKWY
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	OSO PKWY
Google Street View Link:		Stop Condition-Street 2	Signal

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.58804796,-117.60904047

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	140	N/A	Flare Type LT	
Yes	Ramp Width (in)	54			Sloped
Yes	Ramp Run Slope (%)	6.7	N/A	Flare Slope LT (%)	4.8
Yes	Ramp Cross Slope (%)	1.8	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	78			Sloped
Yes	Landing Width (in)	54	Yes	Flare Slope RT (%)	6.6
Yes	Landing Run Slope (%)	1	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.8	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.4		Crossing 2 Slope (%)	3.5
	Crossing 1 Cross Slope (%)	1.1		Crossing 2 Cross Slope (%)	3.4
Yes	Gutter Ponding	No	Yes	Curb Slope	4.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.1
No	Gutter Run Slope (%)	6.1		Road Cross Slope (%)	4.5
Yes	Gutter Cross Slope (%)	1.9			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

