



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SIENNA\_PKWY Cross Street: MAIN\_ST Location: SE

ADA ID: RPRK211022123034 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 26

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

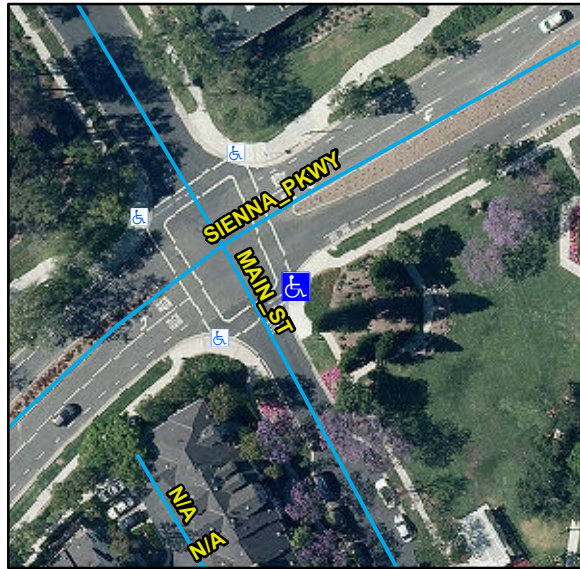

### Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

### Surveyor Notes:

N/A

### OC Std/PROW:

R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 4252

|                          |            |                         |             |
|--------------------------|------------|-------------------------|-------------|
| Parcel ID Number         | 759-361-01 | Street 1 Name           | SIENNA_PKWY |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | StopSign    |
| Ramp Orientation         | Diag       | Street 2 Name           | MAIN_ST     |
| Google Street View Link: |            | Stop Condition-Street 2 | StopSign    |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.56469173,-117.63379831](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56469173,-117.63379831)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data |
|------------|-------------------------------|------------|------------|-------------------------------|------|
| N/A        | Ramp Length LT (in)           | 110        | N/A        | Ramp Length RT (in)           | 125  |
| Yes        | Ramp Width LT (in)            | 90         | Yes        | Ramp Width RT (in)            | 90   |
| Yes        | Ramp Run Slope LT (%)         | 4.9        | Yes        | Ramp Run Slope RT (%)         | 1.8  |
| Yes        | Ramp Cross Slope LT (%)       | 2          | Yes        | Ramp Cross Slope RT (%)       | 1    |
| N/A        | Landing Present               | No         | No         | DWS Provided                  | No   |
| N/A        | Landing Length (in)           | N/A        | N/A        | DWS Contrast                  | N/A  |
| No         | Landing Width (in)            | N/A        | N/A        | DWS Length (in)               | N/A  |
| No         | Landing Run Slope (%)         | N/A        | N/A        | DWS Full Width                | N/A  |
| No         | Landing Cross Slope (%)       | N/A        |            | DWS Offset Type               | N/A  |
| N/A        | Landing Movement Obstructed?  | No         | N/A        | DWS Offset Left (in)          | N/A  |
|            | Landing Movement Type         | Bush       | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Landing Shared                | N/A        |            |                               |      |
| Yes        | Clear Space                   | Yes        |            |                               |      |
| Yes        | Clear Space To Crosswalk (in) | 48         |            |                               |      |
| N/A        | Marked Crosswalk 1            | Yes        | N/A        | Marked Crosswalk 2            | Yes  |
|            | Crossing 1 Direction          | N          |            | Crossing 2 Direction          | W    |
|            | Marked Crosswalk 1 Width (in) | 90         |            | Marked Crosswalk 2 Width (in) | 90   |
| Yes        | Ramp Inside Crosswalk 1       | Yes        | Yes        | Ramp Inside Crosswalk 2       | Yes  |
|            | Crossing 1 Slope (%)          | 0.1        |            | Crossing 2 Slope (%)          | 3    |
|            | Crossing 1 Cross Slope (%)    | 2.1        |            | Crossing 2 Cross Slope (%)    | 3.1  |
| Yes        | Gutter Ponding                | No         | Yes        | Curb Slope                    | 4.6  |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | 2.7  |
| No         | Gutter Run Slope (%)          | 9.6        |            | Road Cross Slope (%)          | 1.5  |
| No         | Gutter Cross Slope (%)        | 4.4        | No         | Perpendicular Joint Present   | No   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |      |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No   |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A  |

