




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SIENNA_PKWY		Cross Street: MAIN_ST		Location:	NW
--------------------------	--	-----------------------	--	-----------	----

ADA ID: RPRK211022124056	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	45
--------------------------	------------------------------	-------------------------	------------------------	-----------------	----

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

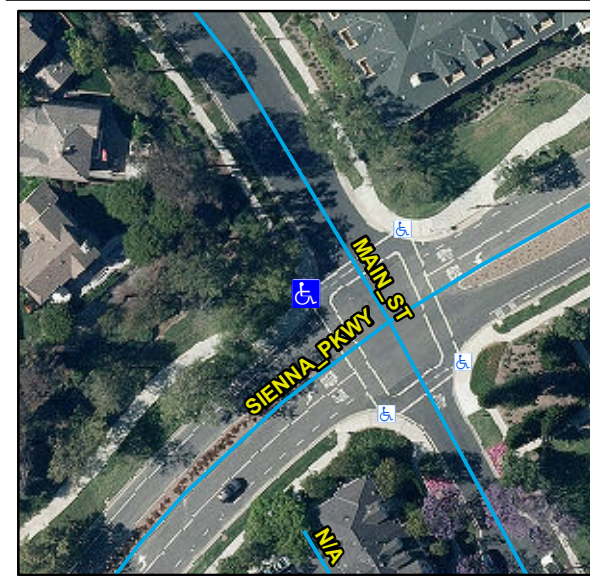

Possible Solutions:	
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	
Surveyor Notes:	
N/A	
OC Std/PROW:	
R204.3, R304.5.3, R304.3.2, STD 1115	
Total Cost:	\$ 4000

Parcel ID Number	759-421-04
Ramp Island Or Median	None
Ramp Orientation	Diag
Google Street View Link:	http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56479332,-117.63408557

Street 1 Name	SIENNA_PKWY
Stop Condition-Street 1	StopSign
Street 2 Name	MAIN_ST
Stop Condition-Street 2	StopSign

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	110	N/A	Ramp Length RT (in)	115
Yes	Ramp Width LT (in)	90	Yes	Ramp Width RT (in)	90
Yes	Ramp Run Slope LT (%)	0.7	No	Ramp Run Slope RT (%)	9
No	Ramp Cross Slope LT (%)	6.9	No	Ramp Cross Slope RT (%)	8.6
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	90		Marked Crosswalk 2 Width (in)	90
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	4.3		Crossing 2 Slope (%)	1.3
	Crossing 1 Cross Slope (%)	3.5		Crossing 2 Cross Slope (%)	4.7
N/A	Gutter Ponding	N/A	N/A	Curb Slope	6.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.4
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

