




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: MAYBECK_LN **Cross Street:** O_NEILL_DR **Location:** SW

ADA ID: RPRK211025121757 **Ramp Type:** Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass **Overall Compliance:** No **Severity Score:** 19

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

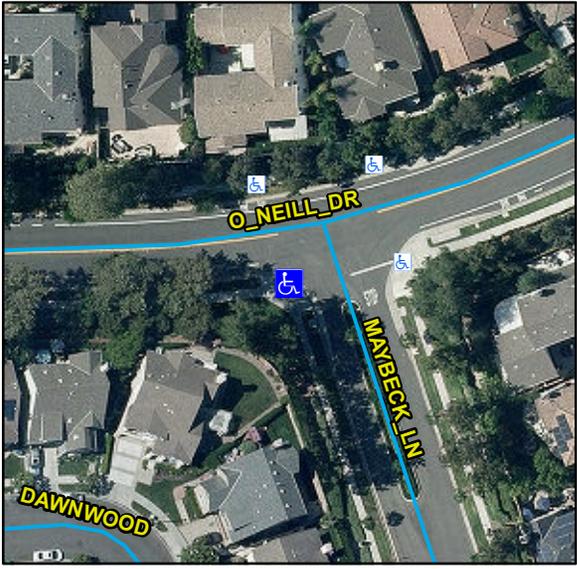

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
 N/A

OC Std/PROW:
 R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.3, STD 1115

Total Cost: \$ 6412

Parcel ID Number: 759-221-56
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.5688762,-117.64157234

Street 1 Name: MAYBECK_LN
Stop Condition-Street 1: StopSign
Street 2 Name: O_NEILL_DR
Stop Condition-Street 2: NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	119	N/A	Flare Type LT	
Yes	Ramp Width (in)	48		Flare Slope LT (%)	3.2
Yes	Ramp Run Slope (%)	7.5	Yes	Flare Traversable LT	Yes
Yes	Ramp Cross Slope (%)	1.2	N/A	Flare Type RT	
N/A	Landing Present	Yes		Flare Slope RT (%)	6.3
N/A	Landing Length (in)	39	N/A	Flare Traversable RT	Yes
Yes	Landing Width (in)	48	Yes	DWS Provided	No
No	Landing Run Slope (%)	5.7	N/A	DWS Contrast	N/A
Yes	Landing Cross Slope (%)	1.2	No	DWS Length (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Full Width	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Landing Shared	No	N/A	DWS Offset Right (in)	N/A
N/A	Clear Space	Yes	N/A	Marked Crosswalk 1	No
N/A	Clear Space To Crosswalk (in)	48	N/A	Crossing 1 Direction	E
N/A	Marked Crosswalk 1	No	N/A	Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2	No
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Marked Crosswalk 2 Width (in)	N/A
	Crossing 1 Slope (%)	1.9		Ramp Inside Crosswalk 2	N/A
	Crossing 1 Cross Slope (%)	0.7		Crossing 1 Slope (%)	2.6
Yes	Gutter Ponding	No	No	Crossing 2 Slope (%)	1.2
Yes	Gutter Lip Height (in)	0		Crossing 2 Cross Slope (%)	13.7
Yes	Gutter Run Slope (%)	4.5		Curb Slope	1
No	Gutter Cross Slope (%)	2.1		Road Run Slope (%)	0.8
Yes	Overall Surface Condition: Acceptable		No	Road Cross Slope (%)	
	Cross Gutter Present?	No		Perp Joint Present	No
	Replace Cross Gutter?	N/A		Spandrel Present?	No
				Replace Spandrel?	N/A

