



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: CECIL_PASTURE_RD Cross Street: CECIL_PASTURE_RD Location: SW

ADA ID: RPRK211026124007 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

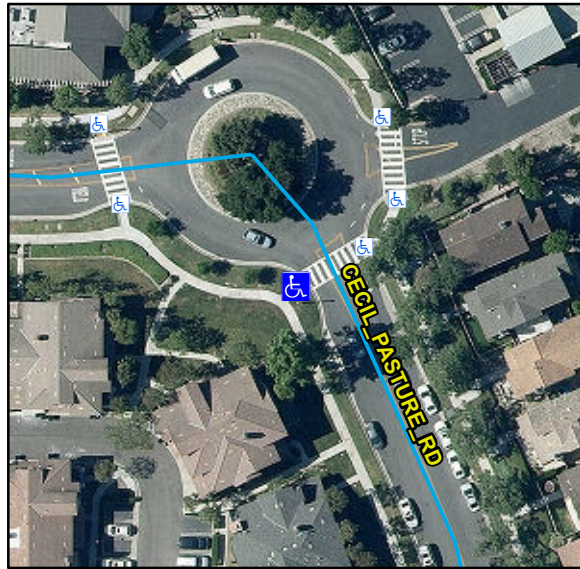

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.2, R304.5.4, STD 1115

Total Cost: \$ 783

Parcel ID Number **759-352-02**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56173675,-117.64680588

Street 1 Name **CECIL_PASTURE_RD**
Stop Condition-Street 1 **YieldSign**
Street 2 Name **CECIL_PASTURE_RD**
Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	168	Yes	Flare Type LT	
Yes	Ramp Width (in)	48			Curbed2
Yes	Ramp Run Slope (%)	7	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.7	N/A	Flare Traversable LT	N/A
No	Grade Break	No	Yes	Flare Type RT	
N/A	Grade Break Slope (%)	8.3			Curbed2
N/A	Grade Break Cross Slope (%)	1.3	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	49	Yes	DWS Length (in)	42
Yes	Landing Width (in)	58	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	0.5		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	0.4	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	Yes	N/A	Clear Space	N/A
	Crossing 1 Direction	E	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	144			
Yes	Ramp Inside Crosswalk 1	Yes			
	Crossing 1 Slope (%)	2.9			
	Crossing 1 Cross Slope (%)	2.4			
Yes	Gutter Ponding	No	Yes	Curb Slope	7.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	11.1		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	2		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

