

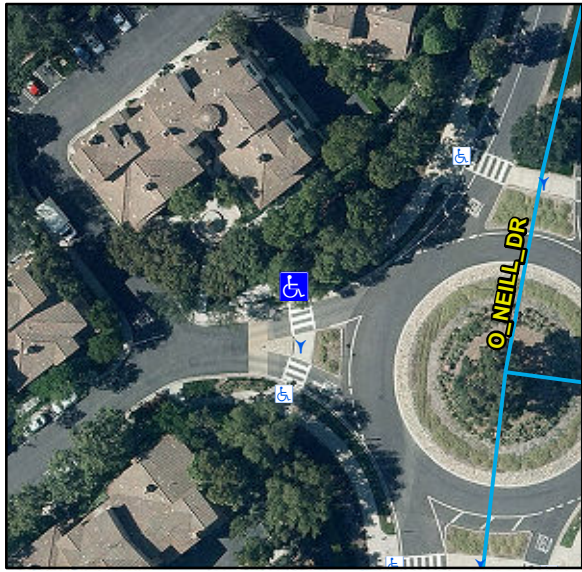


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: DORRANCE_DR		Cross Street: O_NEILL_DR		Location:	W
ADA ID: RPRK211026133137	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	16

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

		Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data					
		Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		75		N/A		Flare Type LT		N/A					
				Yes		Ramp Width (in)		48						N/A					
				No		Ramp Run Slope (%)		10.8		N/A		Flare Slope LT (%)		N/A					
				No		Ramp Cross Slope (%)		4.5		N/A		Flare Traversable LT		N/A					
				N/A		Landing Present		N/A		N/A		Flare Type RT							
				N/A		Landing Length (in)		N/A						N/A					
				N/A		Landing Width (in)		N/A		N/A		Flare Slope RT (%)		N/A					
				N/A		Landing Run Slope (%)		N/A		N/A		Flare Traversable RT		N/A					
				N/A		Landing Cross Slope (%)		N/A		N/A		DWS Provided		N/A					
Surveyor Notes: N/A OC Std/PROW: R304.2.2, R204.3, R304.5.3, STD 1115				N/A		Landing Movement Obstructed?		N/A		N/A		DWS Contrast		N/A					
						Landing Movement Type		N/A		N/A		DWS Length (in)		N/A					
				N/A		Landing Shared		N/A		N/A		DWS Full Width		N/A					
				N/A		Clear Space		N/A		N/A		DWS Offset Left (in)		N/A					
				N/A		Clear Space To Crosswalk (in)		N/A		N/A		DWS Offset Right (in)		N/A					
				N/A		Marked Crosswalk 1		Yes		N/A		Marked Crosswalk 2		N/A					
						Crossing 1 Direction		S				Crossing 2 Direction		N/A					
						Marked Crosswalk 1 Width (in)		145				Marked Crosswalk 2 Width (in)		N/A					
				N/A		Ramp Inside Crosswalk 1		Yes		Yes		Ramp Inside Crosswalk 2		N/A					
						Crossing 1 Slope (%)		0.5				Crossing 2 Slope (%)		N/A					
Total Cost: \$ 3080						Crossing 1 Cross Slope (%)		3.9				Crossing 2 Cross Slope (%)		N/A					
				N/A		Gutter Ponding		N/A		No		Curb Slope		12.4					
				Yes		Gutter Lip Height (in)		0				Road Run Slope (%)		N/A					
				N/A		Gutter Run Slope (%)		N/A				Road Cross Slope (%)		N/A					
				N/A		Gutter Cross Slope (%)		N/A											
				Yes		Overall Surface Condition: Acceptable				No		Perp Joint Present		No					
						Cross Gutter Present?		No				Spandrel Present?		No					
						Replace Cross Gutter?		N/A				Replace Spandrel?		N/A					
Obstruction and Utility Measurement/Component Compliance		Compliance		Description		Data		Compliance		Description		Data		Compliance		Description		Data	
		Yes		Obstructions Present?		No		N/A		Utilities Present?		No							
				Obstruction Types		N/A				Utility Types									
				Obstruction Dimensions		N/A													

