



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: O_NEILL_DR Cross Street: DORRANCE_DR Location: N

ADA ID: RPRK211026133259 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 20

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

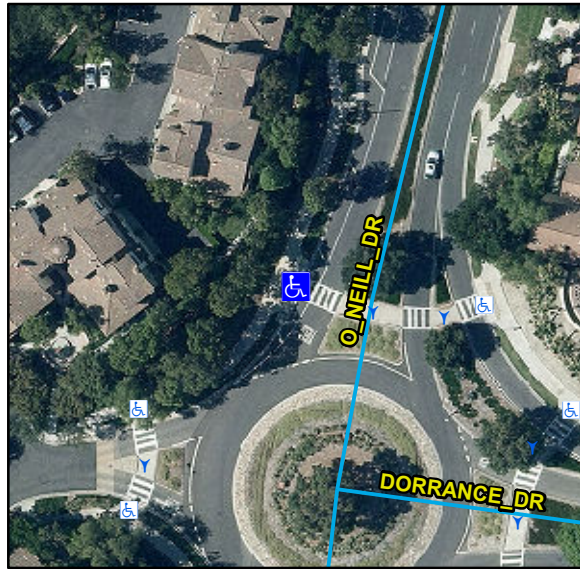

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R304.5.3, R305, STD 1115

Total Cost: \$ 2000

Parcel ID Number 741-111-07
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55518285,-117.64536733

Street 1 Name O_NEILL_DR
Stop Condition-Street 1 YieldSign
Street 2 Name DORRANCE_DR
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	144	N/A	Ramp Length RT (in)	143
Yes	Ramp Width LT (in)	70	Yes	Ramp Width RT (in)	70
Yes	Ramp Run Slope LT (%)	1.9	Yes	Ramp Run Slope RT (%)	7.9
Yes	Ramp Cross Slope LT (%)	1.5	Yes	Ramp Cross Slope RT (%)	1.8
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	SE		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.6		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.8		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	10
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	4.7		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.3	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

