




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ETHEREAL_ST		Cross Street: NARROW_CANYON_RD		Location:	W
ADA ID: RPRK211027135416	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	17

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

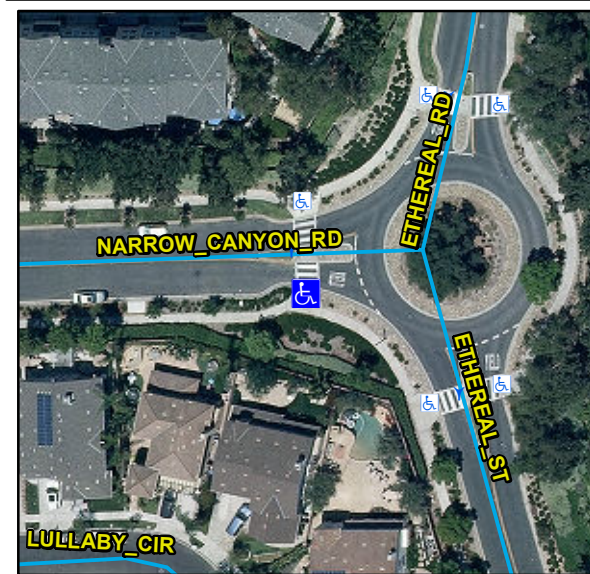

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number	741-371-56	Street 1 Name	ETHEREAL_ST
Ramp Island Or Median	None	Stop Condition-Street 1	YieldSign
Ramp Orientation	NonDiag	Street 2 Name	NARROW_CANYON_RD
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53758538,-117.64380876

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	93	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	8.2	N/A	Flare Slope LT (%)	11.3
Yes	Ramp Cross Slope (%)	2	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	60			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	9.6
No	Landing Run Slope (%)	3.5	N/A	Flare Traversable RT	No
No	Landing Cross Slope (%)	2.1	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	Yes	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	N		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.8		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	8.7		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.9			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

