




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: EPONA WAY **Cross Street: EPONA WAY** **Location: E**

ADA ID: RPRK211027141014 **Ramp Type: Type 4 - Parallel** **Initial Pass/Fail: Pass** **Overall Compliance: No** **Severity Score: 25**

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

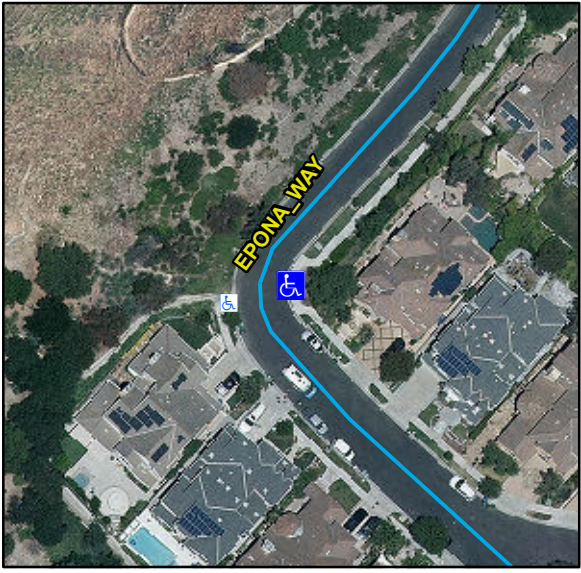

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
 N/A

OC Std/PROW:
R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R302.7, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number: 741-351-49

Ramp Island Or Median: None

Ramp Orientation: Diag

Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53533425,-117.64739391

Street 1 Name: EPONA WAY

Stop Condition-Street 1: NoControl

Street 2 Name: EPONA WAY

Stop Condition-Street 2: NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	128	N/A	Ramp Length RT (in)	126
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	1.6	Yes	Ramp Run Slope RT (%)	6.4
Yes	Ramp Cross Slope LT (%)	0.3	Yes	Ramp Cross Slope RT (%)	1
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.3		Crossing 2 Slope (%)	4
	Crossing 1 Cross Slope (%)	2		Crossing 2 Cross Slope (%)	1
No	Gutter Ponding	Yes	No	Curb Slope	13.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
No	Gutter Run Slope (%)	8.4		Road Cross Slope (%)	2.6
Yes	Gutter Cross Slope (%)	1.2	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

