



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: COPIOUS_LN		Cross Street: EPONA_WAY		Location:	S
ADA ID: RPRK211027142439	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115


Total Cost: \$ 4252

Parcel ID Number	741-351-08	Street 1 Name	COPIOUS_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	EPONA_WAY
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53736086,-117.64680024

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

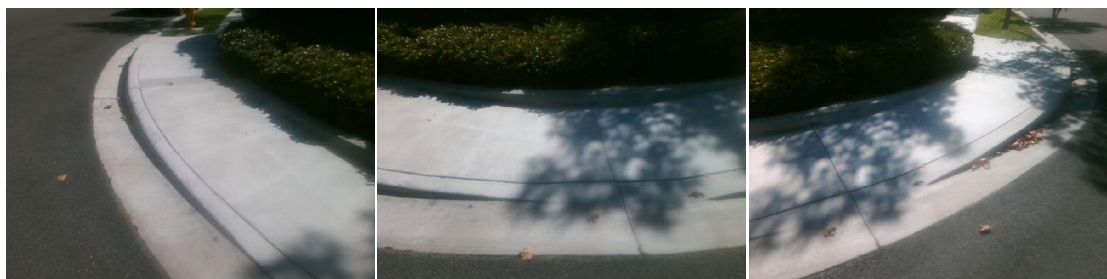

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	134	N/A	Ramp Length RT (in)	140
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	4.9	Yes	Ramp Run Slope RT (%)	4
Yes	Ramp Cross Slope LT (%)	1.4	Yes	Ramp Cross Slope RT (%)	0.8
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.8		Crossing 2 Slope (%)	2.7
	Crossing 1 Cross Slope (%)	0.1		Crossing 2 Cross Slope (%)	3.5
Yes	Gutter Ponding	No	Yes	Curb Slope	4.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
No	Gutter Run Slope (%)	6.3		Road Cross Slope (%)	5.2
Yes	Gutter Cross Slope (%)	1.9	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A