



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: EPONA\_WAY Cross Street: NARROW\_CANYON\_RD Location: W

ADA ID: RPRK211027143505 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 25

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

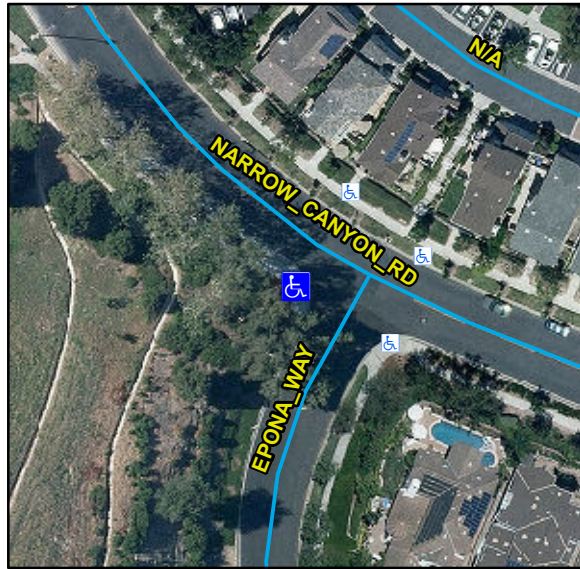

### Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

### Surveyor Notes:

N/A

### OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 4252

|                          |            |                         |                  |
|--------------------------|------------|-------------------------|------------------|
| Parcel ID Number         | 741-281-03 | Street 1 Name           | EPONA_WAY        |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | NoControl        |
| Ramp Orientation         | Diag       | Street 2 Name           | NARROW_CANYON_RD |
| Google Street View Link: |            | Stop Condition-Street 2 | NoControl        |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.53802059,-117.64688027](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53802059,-117.64688027)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data |
|------------|-------------------------------|------------|------------|-------------------------------|------|
| N/A        | Ramp Length LT (in)           | 138        | N/A        | Ramp Length RT (in)           | 141  |
| Yes        | Ramp Width LT (in)            | 98         | Yes        | Ramp Width RT (in)            | 96   |
| Yes        | Ramp Run Slope LT (%)         | 4.3        | Yes        | Ramp Run Slope RT (%)         | 3    |
| Yes        | Ramp Cross Slope LT (%)       | 0.8        | Yes        | Ramp Cross Slope RT (%)       | 0.9  |
| N/A        | Landing Present               | No         | No         | DWS Provided                  | No   |
| N/A        | Landing Length (in)           | N/A        | N/A        | DWS Contrast                  | N/A  |
| No         | Landing Width (in)            | N/A        | N/A        | DWS Length (in)               | N/A  |
| No         | Landing Run Slope (%)         | N/A        | N/A        | DWS Full Width                | N/A  |
| No         | Landing Cross Slope (%)       | N/A        |            | DWS Offset Type               | N/A  |
| N/A        | Landing Movement Obstructed?  | No         | N/A        | DWS Offset Left (in)          | N/A  |
|            | Landing Movement Type         | Curb       | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Landing Shared                | N/A        |            |                               |      |
| N/A        | Clear Space                   | Yes        |            |                               |      |
| N/A        | Clear Space To Crosswalk (in) | 48         |            |                               |      |
| N/A        | Marked Crosswalk 1            | No         | N/A        | Marked Crosswalk 2            | No   |
|            | Crossing 1 Direction          | SE         |            | Crossing 2 Direction          | NE   |
|            | Marked Crosswalk 1 Width (in) | N/A        |            | Marked Crosswalk 2 Width (in) | N/A  |
| N/A        | Ramp Inside Crosswalk 1       | N/A        | N/A        | Ramp Inside Crosswalk 2       | N/A  |
|            | Crossing 1 Slope (%)          | 1.7        |            | Crossing 2 Slope (%)          | 1.7  |
|            | Crossing 1 Cross Slope (%)    | 1.6        |            | Crossing 2 Cross Slope (%)    | 2.3  |
| Yes        | Gutter Ponding                | No         | No         | Curb Slope                    | 12.1 |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | 1.4  |
| No         | Gutter Run Slope (%)          | 10.3       |            | Road Cross Slope (%)          | 0.1  |
| Yes        | Gutter Cross Slope (%)        | 0.4        | No         | Perpendicular Joint Present   | No   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |      |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No   |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A  |

