



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SEA_GRAPE_RD	Cross Street: SNOW_BUSH_ST	Location: SE
---------------------------	----------------------------	--------------

ADA ID: RPRK211028135042	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 25
--------------------------	------------------------------	-------------------------	------------------------	--------------------

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115


Total Cost: \$ 4252

Parcel ID Number	741-282-45	Street 1 Name	SEA_GRAPE_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	SNOW_BUSH_ST
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54070939,-117.64879917

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

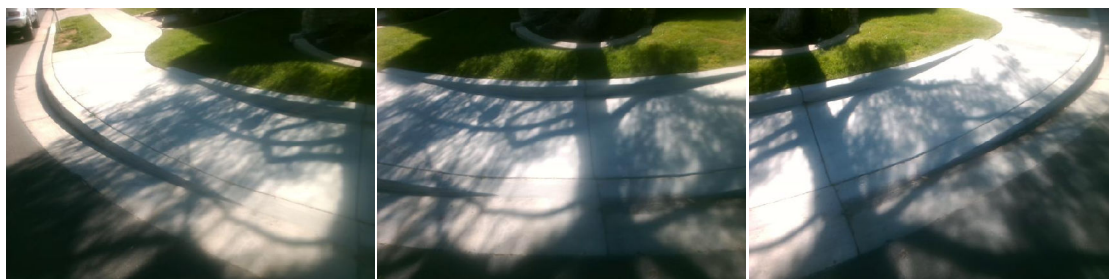

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	122	N/A	Ramp Length RT (in)	132
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	5.3	Yes	Ramp Run Slope RT (%)	6.2
Yes	Ramp Cross Slope LT (%)	1.3	Yes	Ramp Cross Slope RT (%)	1.8
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.9		Crossing 2 Slope (%)	2.8
	Crossing 1 Cross Slope (%)	2		Crossing 2 Cross Slope (%)	2.7
Yes	Gutter Ponding	No	Yes	Curb Slope	8.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.7
No	Gutter Run Slope (%)	8.8		Road Cross Slope (%)	3.9
Yes	Gutter Cross Slope (%)	0.9	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A