



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ANTONIO_PKWY Cross Street: CROWN_VALLEY_PKWY Location: NE

ADA ID: RPRK211101112432 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 16

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

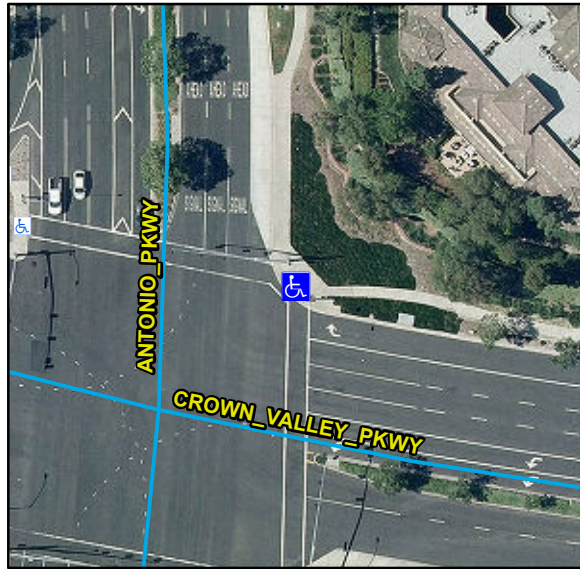

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.4, STD 1115

Total Cost: \$ 852

Parcel ID Number 780-221-19
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56559216,-117.62861684

Street 1 Name ANTONIO_PKWY
Stop Condition-Street 1 Signal
Street 2 Name CROWN_VALLEY_PKWY
Stop Condition-Street 2 Signal

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	108	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.5	Yes	Flare Slope LT (%)	6
Yes	Ramp Cross Slope (%)	1.3	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	61			Sloped
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	8.4
Yes	Landing Run Slope (%)	1.8	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.4	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
Yes	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
Yes	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.4		Crossing 2 Slope (%)	5.8
	Crossing 1 Cross Slope (%)	2.5		Crossing 2 Cross Slope (%)	1.3
Yes	Gutter Ponding	No	Yes	Curb Slope	3.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.1
No	Gutter Run Slope (%)	12.8		Road Cross Slope (%)	1.7
Yes	Gutter Cross Slope (%)	1.5			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

