



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: O\_NEILL\_DR Cross Street: DORRANCE\_DR Location: S

ADA ID: RPRK211102130707 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 15

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

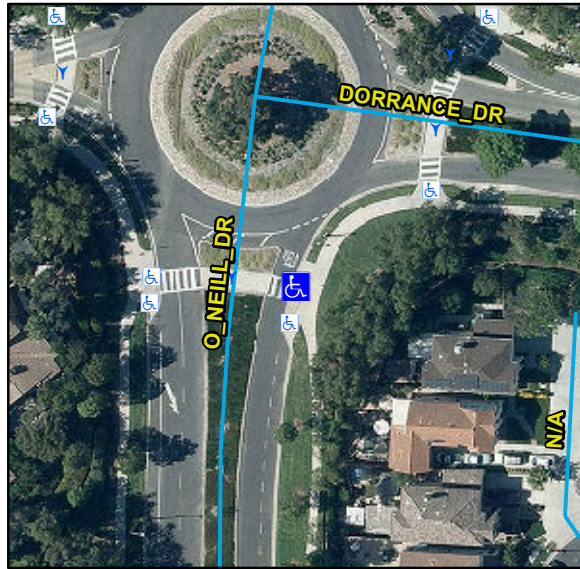

### Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

### Surveyor Notes:

N/A

### OC Std/PROW:

R304.2.1, R305, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ 2252

Parcel ID Number 741-141-49  
Ramp Island Or Median None  
Ramp Orientation NonDiag  
Google Street View Link:

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.55458541,-117.64520864](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55458541,-117.64520864)

Street 1 Name O\_NEILL\_DR  
Stop Condition-Street 1 YieldSign  
Street 2 Name DORRANCE\_DR  
Stop Condition-Street 2 N/A

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data  |
|------------|-------------------------------|------------|------------|-------------------------------|-------|
| N/A        | Ramp Length LT (in)           | 112        | N/A        | Ramp Length RT (in)           | -9999 |
| Yes        | Ramp Width LT (in)            | 53         | N/A        | Ramp Width RT (in)            | -9999 |
| Yes        | Ramp Run Slope LT (%)         | 7.2        | N/A        | Ramp Run Slope RT (%)         | -9999 |
| Yes        | Ramp Cross Slope LT (%)       | 0.7        | N/A        | Ramp Cross Slope RT (%)       | -9999 |
| N/A        | Landing Present               | Yes        | No         | DWS Provided                  | No    |
| N/A        | Landing Length (in)           | 48         | N/A        | DWS Contrast                  | N/A   |
| Yes        | Landing Width (in)            | 48         | N/A        | DWS Length (in)               | N/A   |
| Yes        | Landing Run Slope (%)         | 0          | N/A        | DWS Full Width                | N/A   |
| Yes        | Landing Cross Slope (%)       | 0          |            | DWS Offset Type               | N/A   |
| N/A        | Landing Movement Obstructed?  | Yes        | N/A        | DWS Offset Left (in)          | N/A   |
|            | Landing Movement Type         | Curb       | N/A        | DWS Offset Right (in)         | N/A   |
| N/A        | Landing Shared                | No         |            |                               |       |
| N/A        | Clear Space                   | N/A        |            |                               |       |
| N/A        | Clear Space To Crosswalk (in) | N/A        |            |                               |       |
| N/A        | Marked Crosswalk 1            | Yes        | N/A        | Marked Crosswalk 2            | N/A   |
|            | Crossing 1 Direction          | W          |            | Crossing 2 Direction          | N/A   |
|            | Marked Crosswalk 1 Width (in) | 144        |            | Marked Crosswalk 2 Width (in) | N/A   |
| Yes        | Ramp Inside Crosswalk 1       | Yes        | N/A        | Ramp Inside Crosswalk 2       | N/A   |
|            | Crossing 1 Slope (%)          | 3.3        |            | Crossing 2 Slope (%)          | N/A   |
|            | Crossing 1 Cross Slope (%)    | 3.6        |            | Crossing 2 Cross Slope (%)    | N/A   |
| Yes        | Gutter Ponding                | No         | Yes        | Curb Slope                    | 3.4   |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | N/A   |
| No         | Gutter Run Slope (%)          | 6.7        |            | Road Cross Slope (%)          | N/A   |
| No         | Gutter Cross Slope (%)        | 4.6        | Yes        | Perpendicular Joint Present   | Yes   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |       |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No    |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A   |

