




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SKLAR_ST Cross Street: N/A Location: W

ADA ID: RPRK211103124958 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 25

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

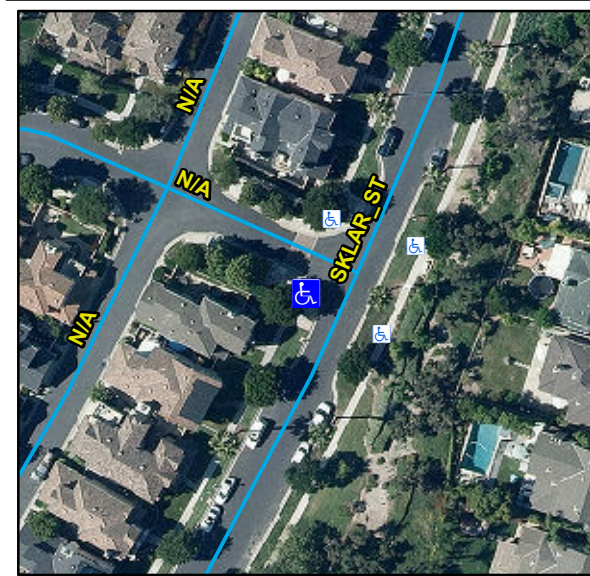

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
N/A

OC Std/PROW:
R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number 741-061-67
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54889642,-117.63273478

Street 1 Name SKLAR_ST
Stop Condition-Street 1 NoControl
Street 2 Name N/A
Stop Condition-Street 2 NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	131	N/A	Ramp Length RT (in)	132
Yes	Ramp Width LT (in)	90	Yes	Ramp Width RT (in)	90
Yes	Ramp Run Slope LT (%)	5.2	Yes	Ramp Run Slope RT (%)	6.6
Yes	Ramp Cross Slope LT (%)	0	Yes	Ramp Cross Slope RT (%)	0.6
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.7		Crossing 2 Slope (%)	3.1
	Crossing 1 Cross Slope (%)	0.3		Crossing 2 Cross Slope (%)	1.5
Yes	Gutter Ponding	No	Yes	Curb Slope	7.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
No	Gutter Run Slope (%)	5.7		Road Cross Slope (%)	3.7
Yes	Gutter Cross Slope (%)	0.4	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

