



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: EPONA_WAY		Cross Street: EPONA_WAY		Location:	W
ADA ID: RPRK211103155422	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--



Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R305, R304.5.4, STD 1115


Total Cost: \$ 3332

Parcel ID Number	741-281-05	Street 1 Name	EPONA_WAY
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	NonDiag	Street 2 Name	EPONA_WAY
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53530474,-117.64750674

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

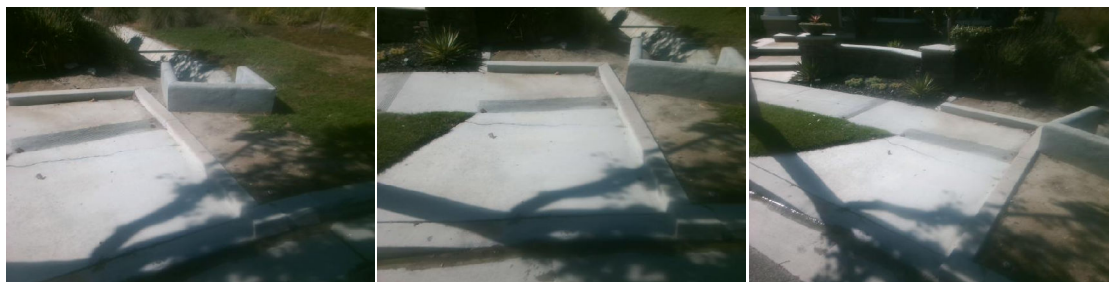

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	55	N/A	Flare Type LT	
Yes	Ramp Width (in)	52			Sloped
Yes	Ramp Run Slope (%)	7.9	N/A	Flare Slope LT (%)	10.5
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	Yes	Flare Type RT	
N/A	Landing Length (in)	48			Curbed2
Yes	Landing Width (in)	52	N/A	Flare Slope RT (%)	N/A
Yes	Landing Run Slope (%)	0.8	N/A	Flare Traversable RT	N/A
Yes	Landing Cross Slope (%)	0.4	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Curb	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	SE		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.1		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	15.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	7.1		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A