



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SIENNA_PKWY Cross Street: SECOND_ST Location: NE

ADA ID: RPRK211108112914 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

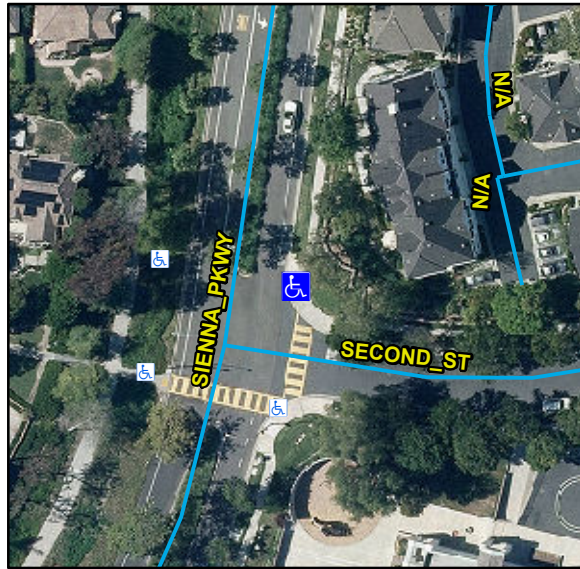

Possible Solutions:

Install Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

Total Cost: \$ 783

Parcel ID Number 759-371-14
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.5626313,-117.63489671

Street 1 Name SIENNA_PKWY
Stop Condition-Street 1 NoControl
Street 2 Name SECOND_ST
Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	89	N/A	Ramp Length RT (in)	68
Yes	Ramp Width LT (in)	86	Yes	Ramp Width RT (in)	86
Yes	Ramp Run Slope LT (%)	7.1	Yes	Ramp Run Slope RT (%)	1
Yes	Ramp Cross Slope LT (%)	0.4	Yes	Ramp Cross Slope RT (%)	0.6
N/A	Landing Present	No	Yes	DWS Provided	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Contrast	Yes
No	Landing Width (in)	N/A	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	N/A	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	N/A		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	120
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.2		Crossing 2 Slope (%)	0.5
	Crossing 1 Cross Slope (%)	4.1		Crossing 2 Cross Slope (%)	3.3
Yes	Gutter Ponding	No	Yes	Curb Slope	3.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3
Yes	Gutter Run Slope (%)	2.9		Road Cross Slope (%)	0.8
No	Gutter Cross Slope (%)	2.2	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

