




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                          |                                  |                           |                        |                 |    |
|--------------------------|----------------------------------|---------------------------|------------------------|-----------------|----|
| Main Street: DORRANCE_DR |                                  | Cross Street: DORRANCE_DR |                        | Location:       | E  |
| ADA ID: RPRK211110131153 | Ramp Type:Type 1 - Perpendicular | Initial Pass/Fail: Pass   | Overall Compliance: No | Severity Score: | 35 |

| Codes/Mitigation Info/Possible Solution |  |  | Field Measurements/Component Compliance |  |  |
|-----------------------------------------|--|--|-----------------------------------------|--|--|
|-----------------------------------------|--|--|-----------------------------------------|--|--|

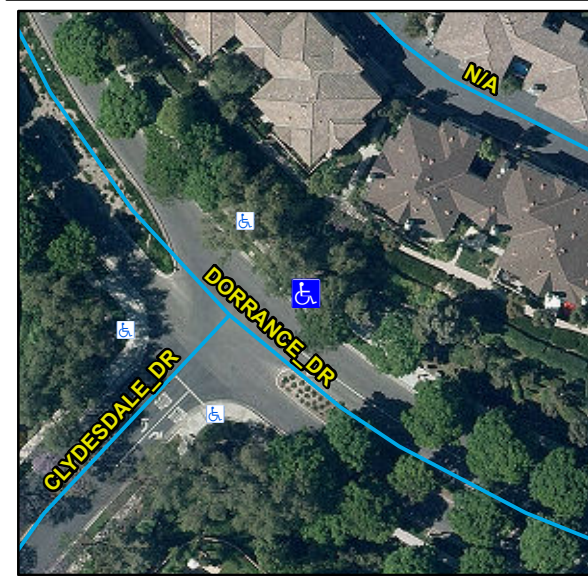

Possible Solutions:

**Remove & Replace Entire Ramp. Remove & Replace Gutter.**

Surveyor Notes:

N/A

OC Std/PROW:

**R304.2.2, R304.5.3, R305, R304.5.4, STD 1115**

Total Cost: \$ 3332

Parcel ID Number **759-601-15**  
Ramp Island Or Median **None**  
Ramp Orientation **NonDiag**  
Google Street View Link:

Street 1 Name **DORRANCE\_DR**  
Stop Condition-Street 1 **NoControl**  
Street 2 Name **DORRANCE\_DR**  
Stop Condition-Street 2 **N/A**

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.55254166,-117.63991538](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55254166,-117.63991538)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                                  | Data | Compliance | Description                   | Data   |
|------------|----------------------------------------------|------|------------|-------------------------------|--------|
| N/A        | Ramp Length (in)                             | 78   | N/A        | Flare Type LT                 |        |
| Yes        | Ramp Width (in)                              | 48   |            |                               | Sloped |
| Yes        | Ramp Run Slope (%)                           | 7.7  | N/A        | Flare Slope LT (%)            | 20.7   |
| No         | Ramp Cross Slope (%)                         | 6    | N/A        | Flare Traversable LT          | No     |
| N/A        | Landing Present                              | Yes  | N/A        | Flare Type RT                 |        |
| N/A        | Landing Length (in)                          | 60   |            |                               | Sloped |
| Yes        | Landing Width (in)                           | 48   | N/A        | Flare Slope RT (%)            | 1.3    |
| Yes        | Landing Run Slope (%)                        | 0.2  | N/A        | Flare Traversable RT          | No     |
| No         | Landing Cross Slope (%)                      | 9.7  | No         | DWS Provided                  | No     |
| N/A        | Landing Movement Obstructed?                 | No   | N/A        | DWS Contrast                  | N/A    |
|            | Landing Movement Type                        | N/A  | N/A        | DWS Length (in)               | N/A    |
| N/A        | Landing Shared                               | No   | N/A        | DWS Full Width                | N/A    |
| N/A        | Clear Space                                  | N/A  | N/A        | DWS Offset Left (in)          | N/A    |
| N/A        | Clear Space To Crosswalk (in)                | N/A  | N/A        | DWS Offset Right (in)         | N/A    |
| N/A        | Marked Crosswalk 1                           | No   | N/A        | Marked Crosswalk 2            | N/A    |
|            | Crossing 1 Direction                         | SW   |            | Crossing 2 Direction          | N/A    |
|            | Marked Crosswalk 1 Width (in)                | N/A  |            | Marked Crosswalk 2 Width (in) | N/A    |
| N/A        | Ramp Inside Crosswalk 1                      | N/A  | Yes        | Ramp Inside Crosswalk 2       | N/A    |
|            | Crossing 1 Slope (%)                         | 0.8  |            | Crossing 2 Slope (%)          | N/A    |
|            | Crossing 1 Cross Slope (%)                   | 7.3  |            | Crossing 2 Cross Slope (%)    | N/A    |
| Yes        | Gutter Ponding                               | No   | No         | Curb Slope                    | 11.3   |
| Yes        | Gutter Lip Height (in)                       | 0    |            | Road Run Slope (%)            | N/A    |
| No         | Gutter Run Slope (%)                         | 7.1  |            | Road Cross Slope (%)          | N/A    |
| No         | Gutter Cross Slope (%)                       | 9    |            |                               |        |
| Yes        | Overall Surface Condition: <b>Acceptable</b> |      | Yes        | Perp Joint Present            | Yes    |
|            | Cross Gutter Present?                        | No   |            | Spandrel Present?             | No     |
|            | Replace Cross Gutter?                        | N/A  |            | Replace Spandrel?             | N/A    |

