




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: DORRANCE_DR		Cross Street: CLYDESDALE_DR		Location:	S
ADA ID: RPRK211110131711	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	32
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

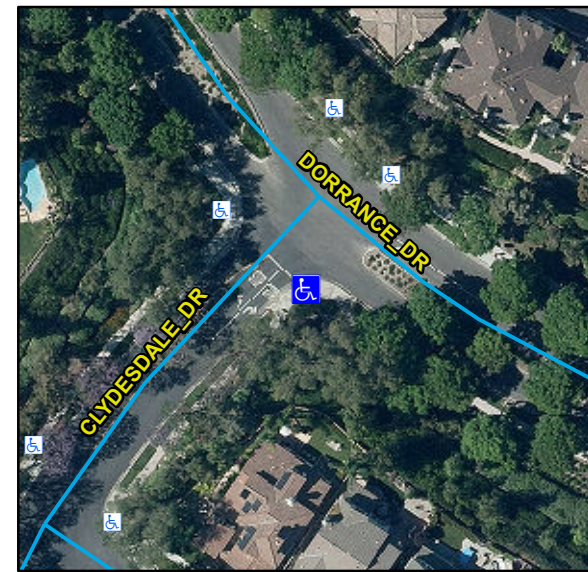

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.5.3, R304.3.2, STD 1115


Total Cost: \$ 8000

Parcel ID Number	741-083-19	Street 1 Name	DORRANCE_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	CLYDESDALE_DR
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55236688,-117.64006792

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

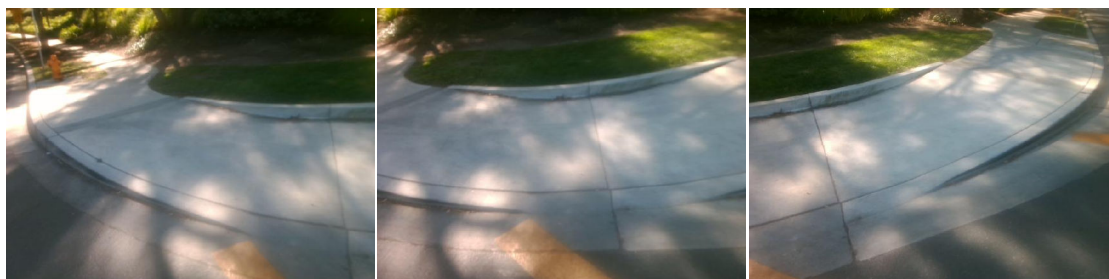

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	135	N/A	Ramp Length RT (in)	133
Yes	Ramp Width LT (in)	90	Yes	Ramp Width RT (in)	90
Yes	Ramp Run Slope LT (%)	4.1	No	Ramp Run Slope RT (%)	19.5
No	Ramp Cross Slope LT (%)	3.7	Yes	Ramp Cross Slope RT (%)	1.9
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	144
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	No
	Crossing 1 Slope (%)	2.3		Crossing 2 Slope (%)	3.7
	Crossing 1 Cross Slope (%)	7		Crossing 2 Cross Slope (%)	6
N/A	Gutter Ponding	N/A	N/A	Curb Slope	6.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	11.2
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.6
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A