



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SIENNA_PKWY		Cross Street: O_NEILL_DR		Location:	NE
ADA ID: RPRK211111130740	Ramp Type: Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.3, STD 1115


Total Cost: \$ 3080

Parcel ID Number 741-071-06
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54531209,-117.6404966

Street 1 Name SIENNA_PKWY
Stop Condition-Street 1 YieldSign
Street 2 Name O_NEILL_DR
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

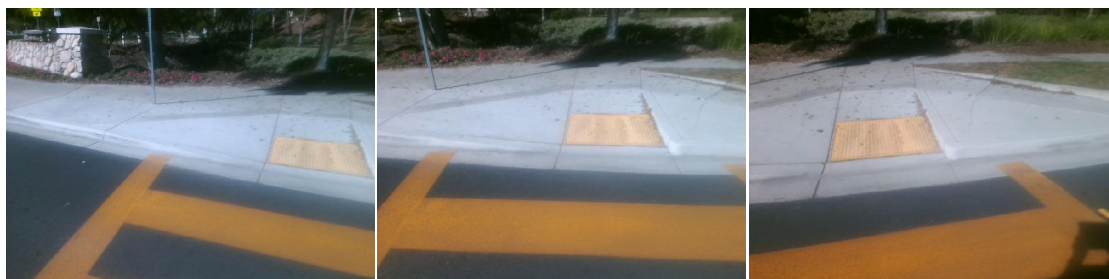

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	85	N/A	Flare Type LT	
Yes	Ramp Width (in)	50			Sloped
Yes	Ramp Run Slope (%)	7.8	N/A	Flare Slope LT (%)	6.5
Yes	Ramp Cross Slope (%)	0.4	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	No	Flare Type RT	
N/A	Landing Length (in)	122			Curbed1
Yes	Landing Width (in)	50	N/A	Flare Slope RT (%)	N/A
Yes	Landing Run Slope (%)	1.2	N/A	Flare Traversable RT	N/A
Yes	Landing Cross Slope (%)	1.3	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	Yes	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.3		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	7.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	2.2		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.6			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A