




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                                         |                              |                           |                                         |                 |    |
|-----------------------------------------|------------------------------|---------------------------|-----------------------------------------|-----------------|----|
| Main Street: DORRANCE_DR                |                              | Cross Street: ST_IVES_WAY |                                         | Location:       | SW |
| ADA ID: RPRK211115114436                | Ramp Type: Type 4 - Parallel | Initial Pass/Fail: Pass   | Overall Compliance: No                  | Severity Score: | 30 |
| Codes/Mitigation Info/Possible Solution |                              |                           | Field Measurements/Component Compliance |                 |    |

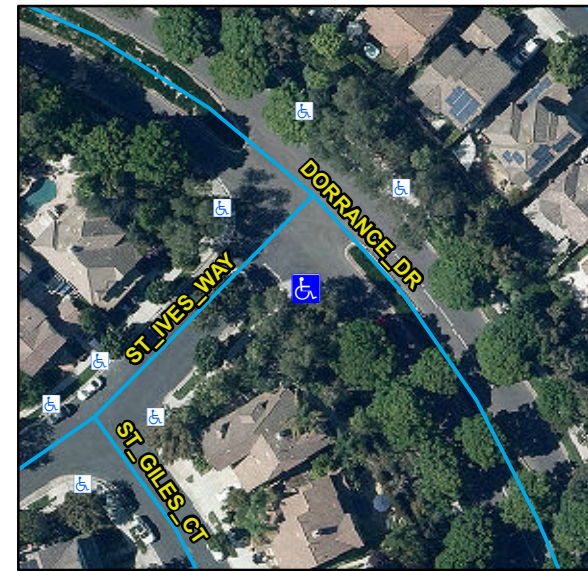

#### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.**

#### Surveyor Notes:

N/A

#### OC Std/PROW:

**R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R302.7.2, STD 1115**


Total Cost: \$ 4150

|                          |            |                         |             |
|--------------------------|------------|-------------------------|-------------|
| Parcel ID Number         | 741-201-43 | Street 1 Name           | DORRANCE_DR |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | NoControl   |
| Ramp Orientation         | Diag       | Street 2 Name           | ST_IVES_WAY |
| Google Street View Link: |            | Stop Condition-Street 2 | StopSign    |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.553949,-117.64121552](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.553949,-117.64121552)

#### Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

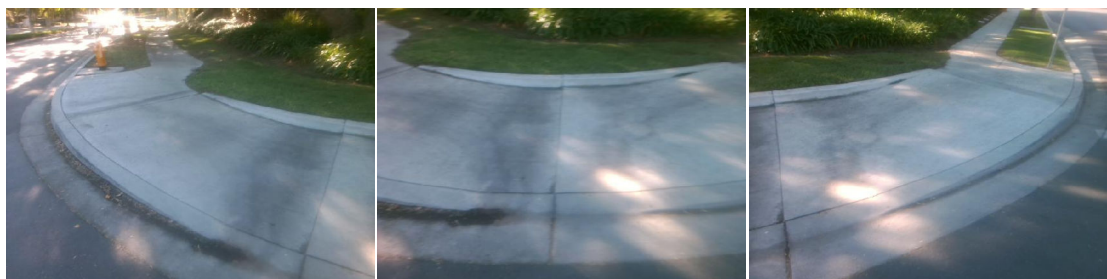

| Compliance | Description                   | Data       | Compliance | Description                   | Data |
|------------|-------------------------------|------------|------------|-------------------------------|------|
| N/A        | Ramp Length LT (in)           | 132        | N/A        | Ramp Length RT (in)           | 137  |
| Yes        | Ramp Width LT (in)            | 89         | Yes        | Ramp Width RT (in)            | 89   |
| Yes        | Ramp Run Slope LT (%)         | 4.2        | Yes        | Ramp Run Slope RT (%)         | 5.1  |
| Yes        | Ramp Cross Slope LT (%)       | 1.4        | Yes        | Ramp Cross Slope RT (%)       | 0.9  |
| N/A        | Landing Present               | No         | No         | DWS Provided                  | No   |
| N/A        | Landing Length (in)           | N/A        | N/A        | DWS Contrast                  | N/A  |
| No         | Landing Width (in)            | N/A        | N/A        | DWS Length (in)               | N/A  |
| No         | Landing Run Slope (%)         | N/A        | N/A        | DWS Full Width                | N/A  |
| No         | Landing Cross Slope (%)       | N/A        |            | DWS Offset Type               | N/A  |
| N/A        | Landing Movement Obstructed?  | No         | N/A        | DWS Offset Left (in)          | N/A  |
|            | Landing Movement Type         | Curb       | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Landing Shared                | N/A        |            |                               |      |
| N/A        | Clear Space                   | Yes        |            |                               |      |
| N/A        | Clear Space To Crosswalk (in) | 48         |            |                               |      |
| N/A        | Marked Crosswalk 1            | No         | N/A        | Marked Crosswalk 2            | No   |
|            | Crossing 1 Direction          | NE         |            | Crossing 2 Direction          | NW   |
|            | Marked Crosswalk 1 Width (in) | N/A        |            | Marked Crosswalk 2 Width (in) | N/A  |
| N/A        | Ramp Inside Crosswalk 1       | N/A        | N/A        | Ramp Inside Crosswalk 2       | N/A  |
|            | Crossing 1 Slope (%)          | 1.2        |            | Crossing 2 Slope (%)          | 1.8  |
|            | Crossing 1 Cross Slope (%)    | 0.9        |            | Crossing 2 Cross Slope (%)    | 1.6  |
| Yes        | Gutter Ponding                | No         | Yes        | Curb Slope                    | 6    |
| No         | Gutter Lip Height (in)        | 1.5        |            | Road Run Slope (%)            | 1.1  |
| Yes        | Gutter Run Slope (%)          | 2.5        |            | Road Cross Slope (%)          | 1.2  |
| Yes        | Gutter Cross Slope (%)        | 0.4        | No         | Perpendicular Joint Present   | No   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |      |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No   |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A  |