




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: BAINBRIDGE_AVE		Cross Street: WHIDBEY_DR		Location:	SE
ADA ID: RPRK211115120901	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	20
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

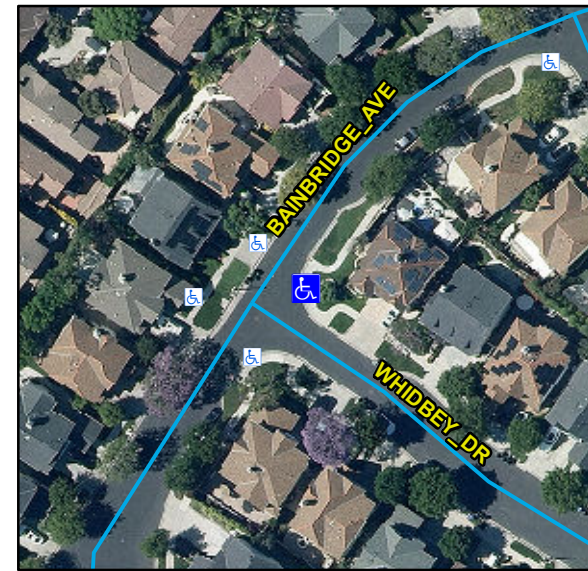

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, STD 1115


Total Cost: \$ 4000

Parcel ID Number	759-642-19	Street 1 Name	BAINBRIDGE_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	WHIDBEY_DR
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55599325,-117.64061439

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

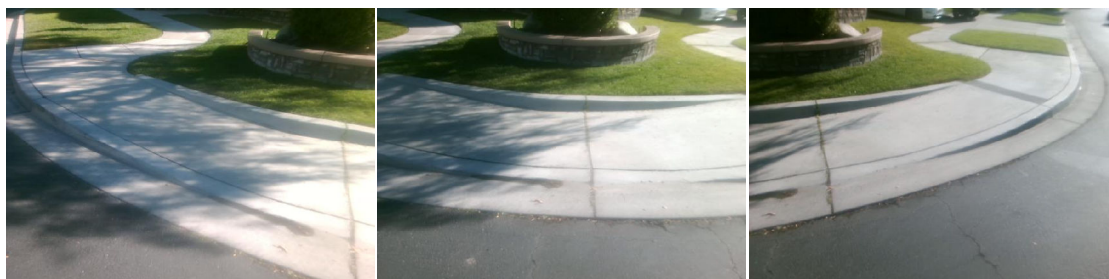

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	137	N/A	Ramp Length RT (in)	113
Yes	Ramp Width LT (in)	52	Yes	Ramp Width RT (in)	52
Yes	Ramp Run Slope LT (%)	6.8	Yes	Ramp Run Slope RT (%)	2.5
Yes	Ramp Cross Slope LT (%)	0.8	Yes	Ramp Cross Slope RT (%)	1.4
N/A	Landing Present	No	No	DWS Provided	No
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
No	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
No	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.3		Crossing 2 Slope (%)	2.4
	Crossing 1 Cross Slope (%)	2.4		Crossing 2 Cross Slope (%)	1.9
Yes	Gutter Ponding	No	Yes	Curb Slope	7.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
Yes	Gutter Run Slope (%)	2.9		Road Cross Slope (%)	2.6
Yes	Gutter Cross Slope (%)	0.1	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A