



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: STATION_WAY Cross Street: ANTONIO_PKWY Location: SE

ADA ID: RPRK211116113224 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 20

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

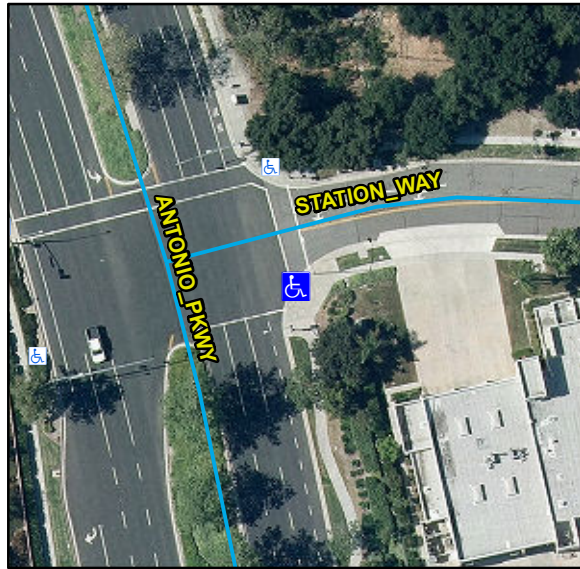

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ 6412

Parcel ID Number 780-221-18
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.56728218,-117.62888668

Street 1 Name STATION_WAY
Stop Condition-Street 1 Signal
Street 2 Name ANTONIO_PKWY
Stop Condition-Street 2 Signal

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48	N/A	Flare Type LT	
Yes	Ramp Width (in)	124			Sloped
Yes	Ramp Run Slope (%)	5.8	Yes	Flare Slope LT (%)	7.7
Yes	Ramp Cross Slope (%)	1	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	41			Sloped
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	7.3
No	Landing Run Slope (%)	3.2	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	1.5	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.4		Crossing 2 Slope (%)	1.9
	Crossing 1 Cross Slope (%)	0.1		Crossing 2 Cross Slope (%)	1.2
Yes	Gutter Ponding	No	No	Curb Slope	11.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2
No	Gutter Run Slope (%)	11.2		Road Cross Slope (%)	0.5
No	Gutter Cross Slope (%)	2.3			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

