



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ANTONIO_PKWY		Cross Street: ANTONIO_PKWY		Location:	NW
ADA ID: RPRK211116115848	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	17

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--



Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, R305, R304.5.4, STD 1115


Total Cost: \$ 3332

Parcel ID Number	759-572-36	Street 1 Name	ANTONIO_PKWY
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	NonDiag	Street 2 Name	ANTONIO_PKWY
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55595302,-117.63079792

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

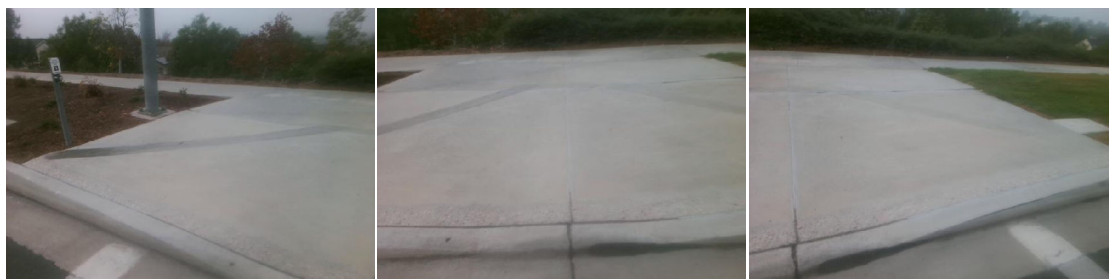

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	125	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	3.9	Yes	Flare Slope LT (%)	3.9
Yes	Ramp Cross Slope (%)	1.7	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	83			Sloped
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	8
Yes	Landing Run Slope (%)	1.4	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	2.4	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.5		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	8.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.4			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A