




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ASCENSO_AVE		Cross Street: N/A		Location:	NE
ADA ID: RPRK211117154529	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	6
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

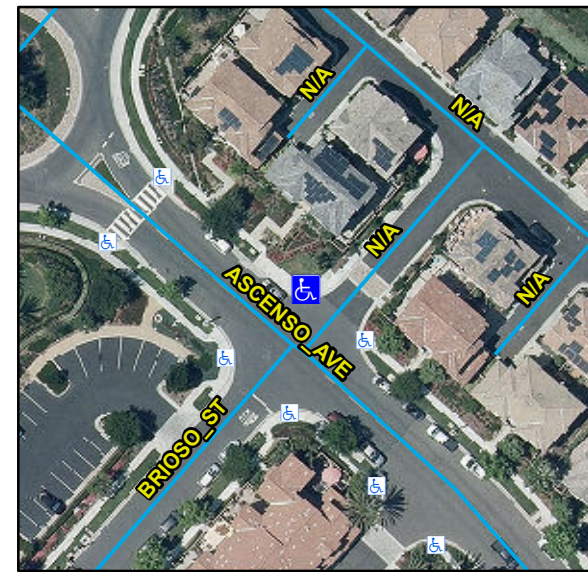

Possible Solutions:

Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, R304.5.4, STD 1115


Total Cost: \$ 783

Parcel ID Number	741-622-76	Street 1 Name	ASCENSO_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	N/A
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.52634809,-117.62337719

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

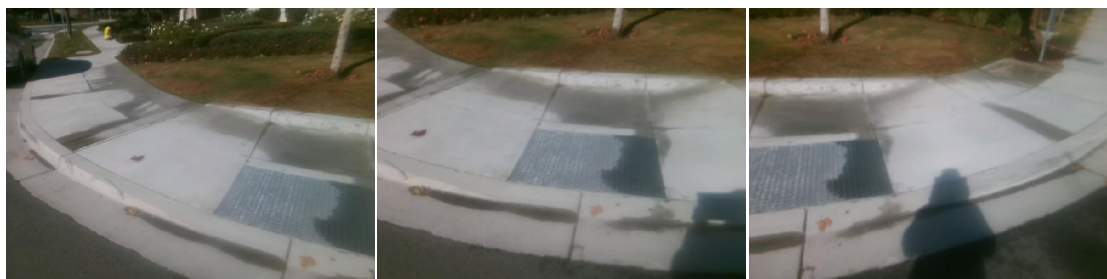

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	67	N/A	Ramp Length RT (in)	64
Yes	Ramp Width LT (in)	89	Yes	Ramp Width RT (in)	89
Yes	Ramp Run Slope LT (%)	6.5	Yes	Ramp Run Slope RT (%)	7.4
Yes	Ramp Cross Slope LT (%)	1.6	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	80	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	2.3	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.5		Crossing 2 Slope (%)	0.7
	Crossing 1 Cross Slope (%)	0.4		Crossing 2 Cross Slope (%)	0.5
Yes	Gutter Ponding	No	Yes	Curb Slope	6.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1
No	Gutter Run Slope (%)	7.6		Road Cross Slope (%)	4.1
Yes	Gutter Cross Slope (%)	0.6	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A