

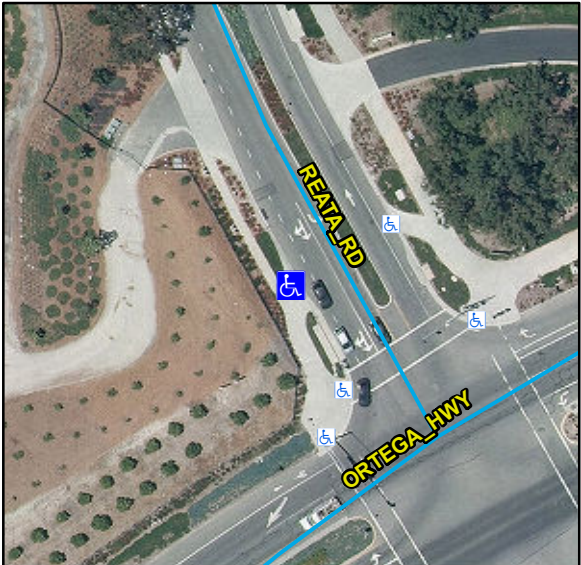


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: REATA_RD		Cross Street: REATA_RD		Location:	W
ADA ID: RPRK211118135946	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	16

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	OC Std/PROW:				
	R304.2.2, R304.5.3, STD 1115				
	Total Cost:	\$	3080		
	Compliance	Description	Data	Compliance	Description
	N/A	Ramp Length (in)	90	N/A	Flare Type LT
	Yes	Ramp Width (in)	220		N/A
	No	Ramp Run Slope (%)	10.6	N/A	Flare Slope LT (%)
	No	Ramp Cross Slope (%)	4.5	N/A	Flare Traversable LT
	N/A	Landing Present	N/A	N/A	Flare Type RT
	N/A	Landing Length (in)	N/A		N/A
	N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)
	N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT
	N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided
	N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast
		Landing Movement Type	N/A	N/A	DWS Length (in)
	N/A	Landing Shared	N/A	N/A	DWS Full Width
	N/A	Clear Space	N/A	N/A	DWS Offset Left (in)
	N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)
	N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2
		Crossing 1 Direction	NE		Crossing 2 Direction
		Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)
	N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2
		Crossing 1 Slope (%)	2.4		Crossing 2 Slope (%)
		Crossing 1 Cross Slope (%)	3.8		Crossing 2 Cross Slope (%)
	N/A	Gutter Ponding	N/A	No	Curb Slope
	Yes	Gutter Lip Height (in)	0		Road Run Slope (%)
	N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)
	N/A	Gutter Cross Slope (%)	N/A		
	Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present
		Cross Gutter Present?	No		Spandrel Present?
		Replace Cross Gutter?	N/A		Replace Spandrel?

Parcel ID Number	125-201-32	Street 1 Name	REATA_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	NonDiag	Street 2 Name	REATA_RD
Google Street View Link:		Stop Condition-Street 2	N/A
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.51885283,-117.62764676			

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

