




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ANTONIO_PKWY		Cross Street: COW_CAMP_RD		Location:	N
ADA ID: RPRK211123131207	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	30

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

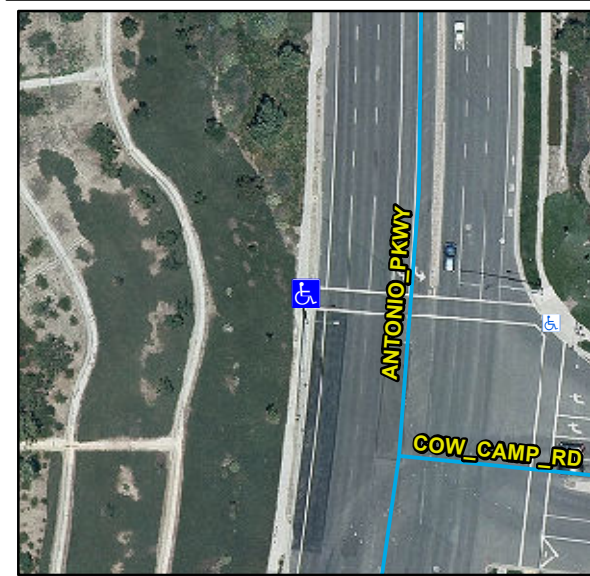

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.3.2, STD 1115

Total Cost: \$ 2000

Parcel ID Number **741-591-41**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.52661548,-117.6189129

Street 1 Name **ANTONIO_PKWY**
Stop Condition-Street 1 **Signal**
Street 2 Name **COW_CAMP_RD**
Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	71	N/A	Ramp Length RT (in)	92
Yes	Ramp Width LT (in)	96	Yes	Ramp Width RT (in)	96
Yes	Ramp Run Slope LT (%)	4.7	No	Ramp Run Slope RT (%)	16.1
Yes	Ramp Cross Slope LT (%)	0.8	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.3		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3.6		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	N/A	Curb Slope	8.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

