




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                          |                                   |                                  |                        |                 |    |
|--------------------------|-----------------------------------|----------------------------------|------------------------|-----------------|----|
| Main Street: COW_CAMP_RD |                                   | Cross Street: CHIQUITA_CANYON_DR |                        | Location:       | S  |
| ADA ID: RPRK211124121020 | Ramp Type: Type 1 - Perpendicular | Initial Pass/Fail: Pass          | Overall Compliance: No | Severity Score: | 10 |

| Codes/Mitigation Info/Possible Solution |  | Field Measurements/Component Compliance |  |
|-----------------------------------------|--|-----------------------------------------|--|
|-----------------------------------------|--|-----------------------------------------|--|

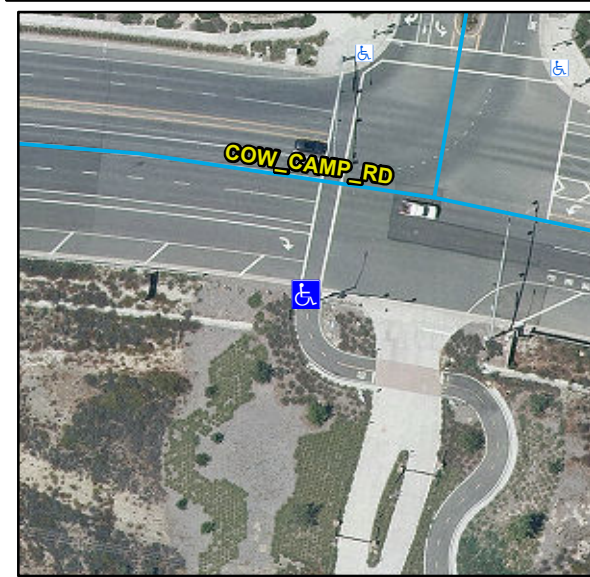

Possible Solutions:

Install Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R302.7, STD 1115

Total Cost: \$ 783

|                          |            |                         |                    |
|--------------------------|------------|-------------------------|--------------------|
| Parcel ID Number         | 755-311-11 | Street 1 Name           | COW_CAMP_RD        |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | Signal             |
| Ramp Orientation         | NonDiag    | Street 2 Name           | CHIQUITA_CANYON_DR |
| Google Street View Link: |            | Stop Condition-Street 2 | N/A                |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.52906687,-117.60606783](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.52906687,-117.60606783)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                           | Data | Compliance | Description                   | Data    |
|------------|---------------------------------------|------|------------|-------------------------------|---------|
| N/A        | Ramp Length (in)                      | 102  | Yes        | Flare Type LT                 | Curbed2 |
| Yes        | Ramp Width (in)                       | 165  |            |                               |         |
| Yes        | Ramp Run Slope (%)                    | 0.7  | N/A        | Flare Slope LT (%)            | N/A     |
| Yes        | Ramp Cross Slope (%)                  | 1.3  | N/A        | Flare Traversable LT          | N/A     |
| N/A        | Landing Present                       | No   | Yes        | Flare Type RT                 | Curbed2 |
| N/A        | Landing Length (in)                   | N/A  |            |                               |         |
| No         | Landing Width (in)                    | N/A  | N/A        | Flare Slope RT (%)            | N/A     |
| No         | Landing Run Slope (%)                 | N/A  | N/A        | Flare Traversable RT          | N/A     |
| No         | Landing Cross Slope (%)               | N/A  | Yes        | DWS Provided                  | Yes     |
| N/A        | Landing Movement Obstructed?          | No   | Yes        | DWS Contrast                  | Yes     |
|            | Landing Movement Type                 | N/A  | Yes        | DWS Length (in)               | 36      |
| N/A        | Landing Shared                        | N/A  | Yes        | DWS Full Width                | Yes     |
| N/A        | Clear Space                           | N/A  | Yes        | DWS Offset Left (in)          | 0       |
| N/A        | Clear Space To Crosswalk (in)         | N/A  | Yes        | DWS Offset Right (in)         | N/A     |
| N/A        | Marked Crosswalk 1                    | Yes  | N/A        | Marked Crosswalk 2            | N/A     |
|            | Crossing 1 Direction                  | N    |            | Crossing 2 Direction          | N/A     |
|            | Marked Crosswalk 1 Width (in)         | 144  |            | Marked Crosswalk 2 Width (in) | N/A     |
| Yes        | Ramp Inside Crosswalk 1               | Yes  | Yes        | Ramp Inside Crosswalk 2       | N/A     |
|            | Crossing 1 Slope (%)                  | 3.8  |            | Crossing 2 Slope (%)          | N/A     |
|            | Crossing 1 Cross Slope (%)            | 1.9  |            | Crossing 2 Cross Slope (%)    | N/A     |
| No         | Gutter Ponding                        | Yes  | Yes        | Curb Slope                    | 0.3     |
| Yes        | Gutter Lip Height (in)                | 0    |            | Road Run Slope (%)            | N/A     |
| Yes        | Gutter Run Slope (%)                  | 4.9  |            | Road Cross Slope (%)          | N/A     |
| No         | Gutter Cross Slope (%)                | 2.2  |            |                               |         |
| Yes        | Overall Surface Condition: Acceptable |      | Yes        | Perp Joint Present            | Yes     |
|            | Cross Gutter Present?                 | No   |            | Spandrel Present?             | No      |
|            | Replace Cross Gutter?                 | N/A  |            | Replace Spandrel?             | N/A     |

