




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: FAUNA_DR		Cross Street: FAUNA_DR		Location:	S
ADA ID: RPRK211124123529	Ramp Type: Type 6 - Directional 1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	16

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

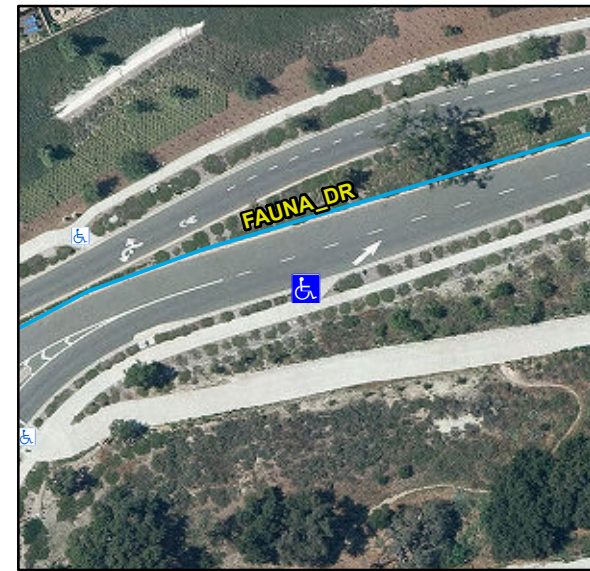

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2, R304.5.3, STD 1115

Total Cost: \$ 3080


Parcel ID Number **755-301-24**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

Street 1 Name **FAUNA_DR**
Stop Condition-Street 1 **NoControl**
Street 2 Name **FAUNA_DR**
Stop Condition-Street 2 **N/A**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53360791,-117.60668095

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	N/A
	Obstruction Dimensions	N/A			N/A

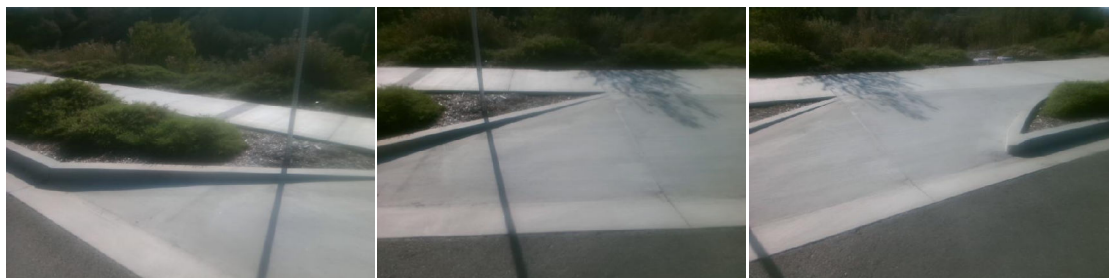

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	104	N/A	Flare Type LT	
Yes	Ramp Width (in)	208			N/A
No	Ramp Run Slope (%)	9.5	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	2.4	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	NE	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.8			
	Crossing 1 Cross Slope (%)	2.1			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	10.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A