



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ANDAZA_ST Cross Street: ESENCIA_DR Location: E

ADA ID: RPRK211129122712 Ramp Type: Type 1 - Perpendicular Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

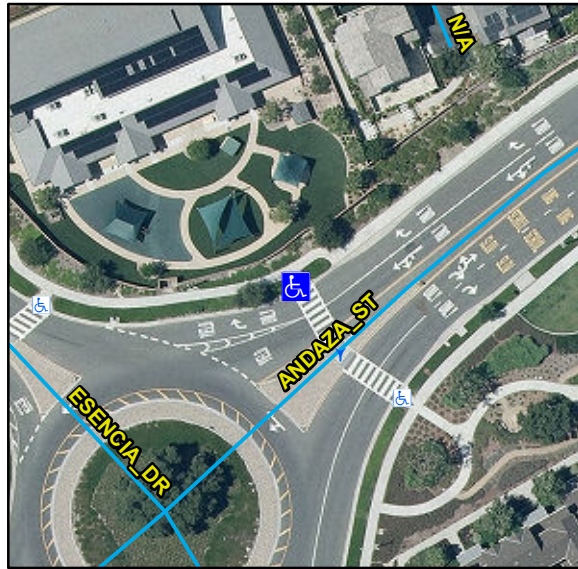

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, STD 1115

Total Cost: \$ 3080

Parcel ID Number 755-411-19

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53416058,-117.60094084

Street 1 Name ANDAZA_ST

Stop Condition-Street 1 YieldSign

Street 2 Name ESENCIA_DR

Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	86	N/A	Flare Type LT	
Yes	Ramp Width (in)	60			Sloped
Yes	Ramp Run Slope (%)	6.7	N/A	Flare Slope LT (%)	13.8
Yes	Ramp Cross Slope (%)	1	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	69			Sloped
Yes	Landing Width (in)	66	N/A	Flare Slope RT (%)	5.5
Yes	Landing Run Slope (%)	0.4	N/A	Flare Traversable RT	No
No	Landing Cross Slope (%)	2.6	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	SE		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	2.6		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	12.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	4.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

