



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **ANDAZA_ST** Cross Street: **TIERNO_RD** Location: **W**

ADA ID: **RPRK211129132906** Ramp Type: **Type 4 - Parallel** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **2**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

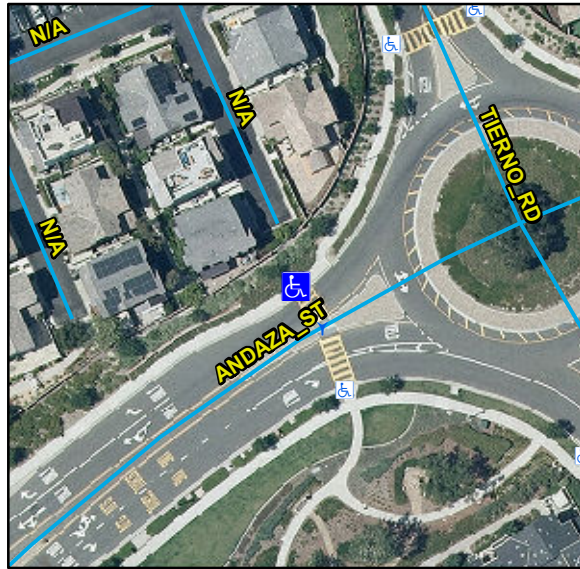

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.3, STD 1115

Total Cost: \$ **2000**

Parcel ID Number **755-412-74**
Ramp Island Or Median **None**
Ramp Orientation **NonDiag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53456063,-117.60027414

Street 1 Name **ANDAZA_ST**
Stop Condition-Street 1 **NoControl**
Street 2 Name **TIERNO_RD**
Stop Condition-Street 2 **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	120	N/A	Ramp Length RT (in)	121
Yes	Ramp Width LT (in)	66	Yes	Ramp Width RT (in)	66
Yes	Ramp Run Slope LT (%)	2.1	Yes	Ramp Run Slope RT (%)	5.9
No	Ramp Cross Slope LT (%)	2.4	Yes	Ramp Cross Slope RT (%)	0.4
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.6		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.5		Crossing 2 Cross Slope (%)	N/A
N/A	Gutter Ponding	N/A	No	Curb Slope	9.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

