




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ANGLER_LN		Cross Street: BELLWOOD_RD		Location:	NW
ADA ID: RPRK211209114027	Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass		Overall Compliance: No	Severity Score:	10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

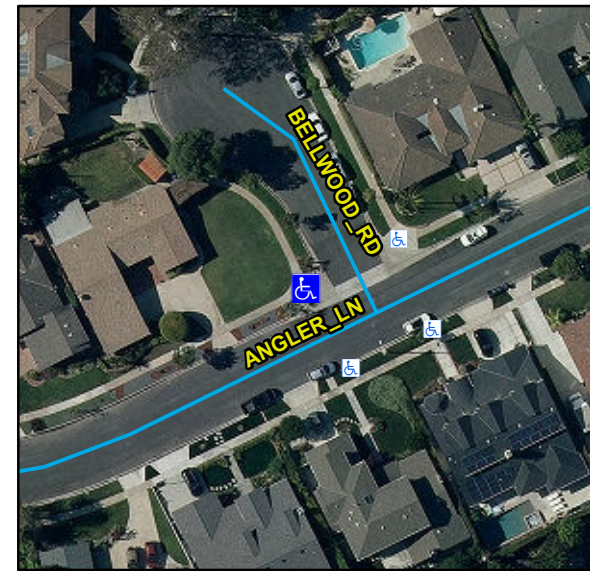

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

OC Std/PROW:
R204.3, R305, STD 1115

Total Cost: \$ **6160**

Parcel ID Number	086-231-12	Street 1 Name	ANGLER_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	BELLWOOD_RD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78202444,-118.08261288

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	5.9	N/A	Flare Slope LT (%)	0.6
Yes	Ramp Cross Slope (%)	1.2	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	49			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	7.3
Yes	Landing Run Slope (%)	0.2	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	1.4	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	7.8		Crossing 2 Slope (%)	3.6
	Crossing 1 Cross Slope (%)	2.9		Crossing 2 Cross Slope (%)	3.3
Yes	Gutter Ponding	No	Yes	Curb Slope	2.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4
Yes	Gutter Run Slope (%)	2		Road Cross Slope (%)	1.2
Yes	Gutter Cross Slope (%)	3.6			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No