




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: WALLINGSFORD_RD	Cross Street: HARRISBURG_RD	Location: NE
------------------------------	-----------------------------	--------------

ADA ID: RPRK211215115808	Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 12
--------------------------	--	------------------------	--------------------

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

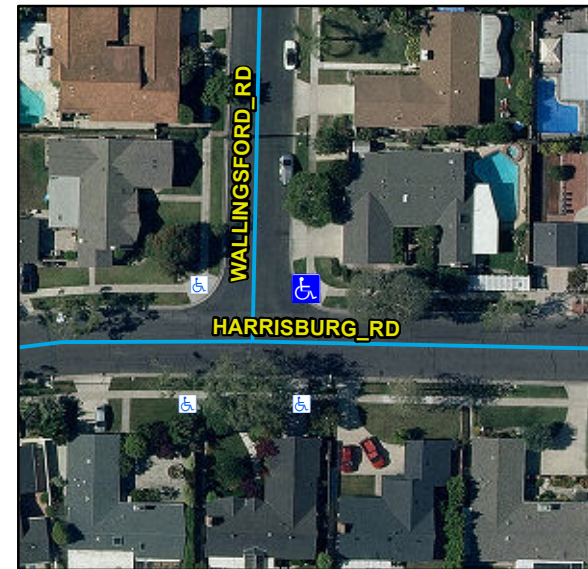

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.
Surveyor Notes:
N/A
OC Std/PROW:
R304.2.2, R204.3, R304.2.2-Perp, R304.3.2-Para, R305, R302.7, STD 1115
Total Cost:
\$ 6160

Parcel ID Number	086-042-08	Street 1 Name	WALLINGSFORD_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	HARRISBURG_RD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79686828,-118.07432306

Obstruction and Utility Measurement/Component Compliance					
Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	8.2	N/A	Flare Slope LT (%)	5.2
Yes	Ramp Cross Slope (%)	0.5	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	2.7
No	Landing Run Slope (%)	3.5	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	2	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.7		Crossing 2 Slope (%)	7.3
	Crossing 1 Cross Slope (%)	0.7		Crossing 2 Cross Slope (%)	1.2
No	Gutter Ponding	Yes	No	Curb Slope	9.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.1
Yes	Gutter Run Slope (%)	3.4		Road Cross Slope (%)	3.8
Yes	Gutter Cross Slope (%)	0.5			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A