




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: KENSINGTON_RD		Cross Street: SALMON_DR		Location:	NE
ADA ID: RPRK211216113316	Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass		Overall Compliance: No	Severity Score:	10
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

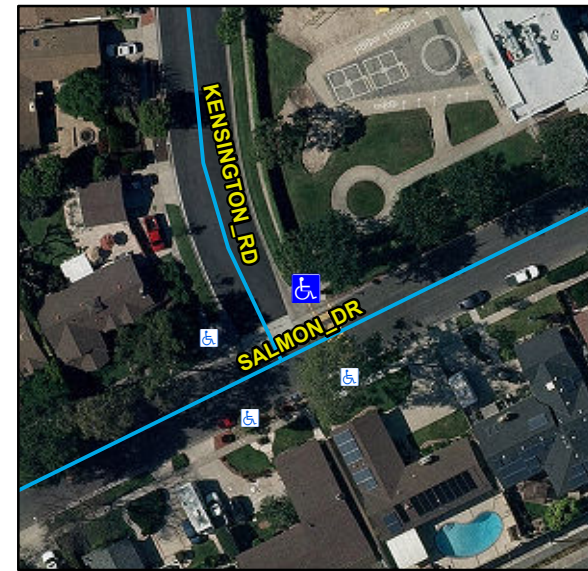

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R305, STD 1115


Total Cost: \$ 6160

Parcel ID Number	086-434-01	Street 1 Name	KENSINGTON_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	SALMON_DR
Google Street View Link:		Stop Condition-Street 2	YieldSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.77896586,-118.08770954

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	<Null>		Mail Box	

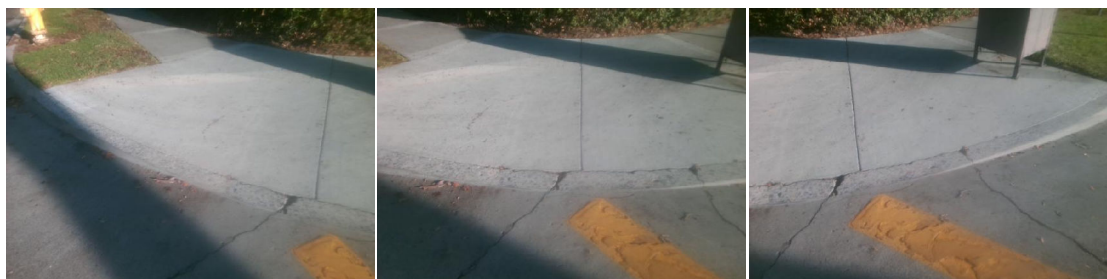

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	79	N/A	Flare Type LT	
Yes	Ramp Width (in)	48		Sloped	
Yes	Ramp Run Slope (%)	8	N/A	Flare Slope LT (%)	5.9
Yes	Ramp Cross Slope (%)	0.3	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	52		Sloped	
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	4
Yes	Landing Run Slope (%)	0.7	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.8	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	120
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	2.7		Crossing 2 Slope (%)	5
	Crossing 1 Cross Slope (%)	5.3		Crossing 2 Cross Slope (%)	1.8
Yes	Gutter Ponding	No	No	Curb Slope	5.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.4
Yes	Gutter Run Slope (%)	0.5		Road Cross Slope (%)	2.2
Yes	Gutter Cross Slope (%)	0.1			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No