




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LOS_ALAMITOS_BLV D Cross Street: ORANGEWOOD_AVE Location: NE

ADA ID: RPRK211217115925 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

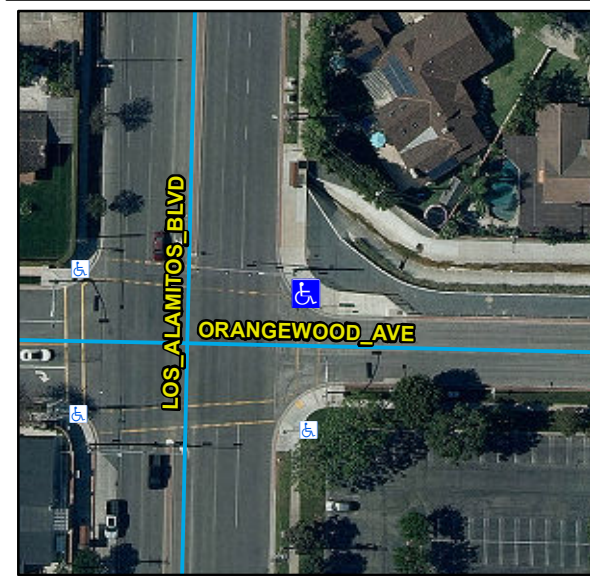

Possible Solutions:
Remove & Replace Curb Slope. Remove & Replace Gutter.

Surveyor Notes:
N/A


OC Std/PROW:
R304.2.2, R304.5.4, STD 1115

Total Cost: \$ 504

Parcel ID Number 000 Street 1 Name LOS_ALAMITOS_BLV D
Ramp Island Or Median None Stop Condition-Street 1 Signal
Ramp Orientation Diag Street 2 Name ORANGEWOOD_AVE
Google Street View Link: Stop Condition-Street 2 Signal
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79593656,-118.07171736

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

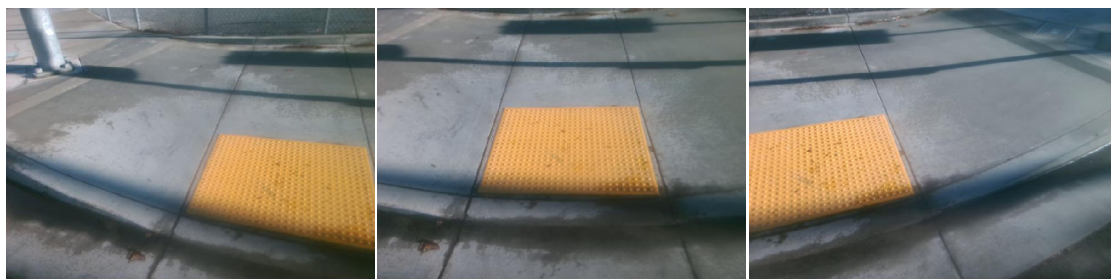

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	6.9	Yes	Flare Slope LT (%)	8.4
Yes	Ramp Cross Slope (%)	0.7	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	6.3
Yes	Landing Run Slope (%)	1.5	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.6	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	1
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	5.5		Crossing 2 Slope (%)	7.5
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	2.4
Yes	Gutter Ponding	No	No	Curb Slope	5.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
No	Gutter Run Slope (%)	12.3		Road Cross Slope (%)	7.4
Yes	Gutter Cross Slope (%)	0.3			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A