



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)




Main Street: LOS_ALAMITOS_BLVDCross Street: ROSSMOOR_WAYLocation: NE

ADA ID: RPRK211217125324Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: PassOverall Compliance: NoSeverity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

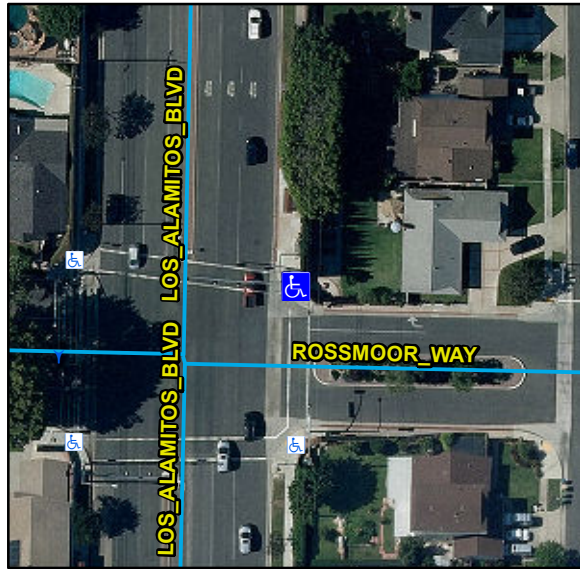

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, STD 1115

Total Cost: \$ 6160

Parcel ID Number 130-751-06
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79255049,-118.07174492

Street 1 Name LOS_ALAMITOS_BLVDCross Street: ROSSMOOR_WAY
Stop Condition-Street 1 Signal
Stop Condition-Street 2 Signal

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	58	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	1.6	N/A	Flare Slope LT (%)	8.2
Yes	Ramp Cross Slope (%)	1.7	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	40			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	3.7
Yes	Landing Run Slope (%)	1.1	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	1.4	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	1
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	3.7		Crossing 2 Slope (%)	5.5
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	2.3
Yes	Gutter Ponding	No	No	Curb Slope	7.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
Yes	Gutter Run Slope (%)	0.8		Road Cross Slope (%)	0.7
Yes	Gutter Cross Slope (%)	0.6			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

