



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: OAK_KNOLL_DR		Cross Street: WEATHERBY_RD		Location:	NW
ADA ID: RPRK211217134913	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	14
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R305.1.4, R302.7, R304.5.4, STD 1115


Total Cost: \$ 4252

Parcel ID Number	086-103-06	Street 1 Name	OAK_KNOLL_DR
Ramp Island Or Median	None	Stop Condition-Street 1	YieldSign
Ramp Orientation	Diag	Street 2 Name	WEATHERBY_RD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79027906,-118.07355113

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

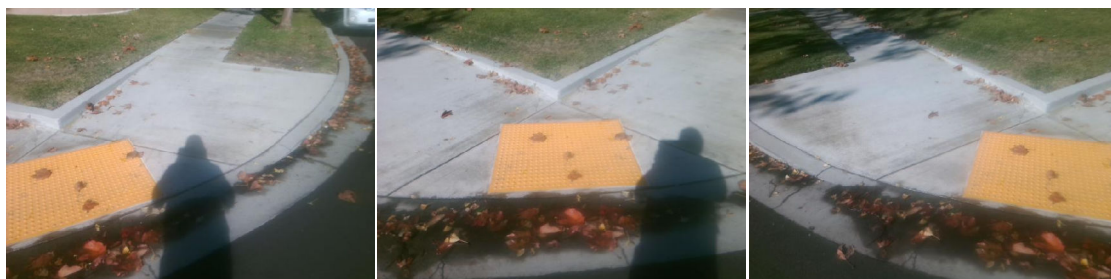

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	101	N/A	Ramp Length RT (in)	98
Yes	Ramp Width LT (in)	100	Yes	Ramp Width RT (in)	105
Yes	Ramp Run Slope LT (%)	5.2	Yes	Ramp Run Slope RT (%)	6.4
Yes	Ramp Cross Slope LT (%)	1.4	Yes	Ramp Cross Slope RT (%)	0.4
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	36	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.4	No	DWS Full Width	No
Yes	Landing Cross Slope (%)	0.5		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	2
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.7		Crossing 2 Slope (%)	6
	Crossing 1 Cross Slope (%)	0.2		Crossing 2 Cross Slope (%)	2.2
No	Gutter Ponding	Yes	Yes	Curb Slope	1.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.3
No	Gutter Run Slope (%)	5.4		Road Cross Slope (%)	5.9
Yes	Gutter Cross Slope (%)	0.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A