



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: WEMBLEY_RD Cross Street: BOSTONIAN_DR Location: NE

ADA ID: RPRK211220125322 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

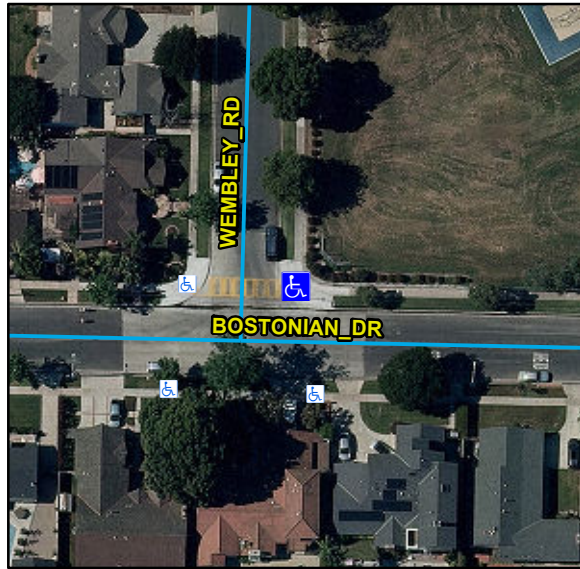

Possible Solutions:

Remove & Replace Landing. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, STD 1115

Total Cost: \$ 531

Parcel ID Number **086-381-01**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78864098,-118.08608013

Street 1 Name **WEMBLEY_RD**
Stop Condition-Street 1 **NoControl**
Street 2 Name **BOSTONIAN_DR**
Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	<Null>		Street Sign	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.5	N/A	Flare Slope LT (%)	8.5
Yes	Ramp Cross Slope (%)	0.5	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	6.4
Yes	Landing Run Slope (%)	1.8	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	1.2	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	145		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.9		Crossing 2 Slope (%)	3.8
	Crossing 1 Cross Slope (%)	1.2		Crossing 2 Cross Slope (%)	1.6
Yes	Gutter Ponding	No	Yes	Curb Slope	3.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
Yes	Gutter Run Slope (%)	0.8		Road Cross Slope (%)	1.7
Yes	Gutter Cross Slope (%)	0.3			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

