



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: GERTRUDE\_DR Cross Street: KENSINGTON\_RD Location: NW

ADA ID: RPRK211220141233 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

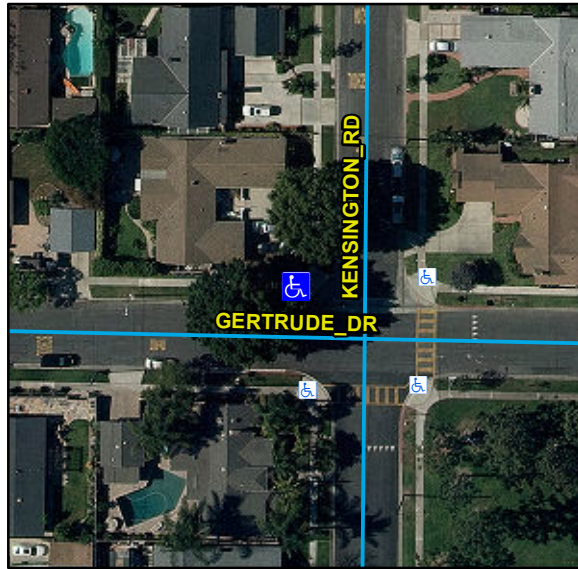

### Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.

### Surveyor Notes:

N/A

### OC Std/PROW:

R204.3, R304.2.2-Perp, R304.3.2-Para, R305, R302.7, STD 1115

Total Cost: \$ 6412

Parcel ID Number 086-441-04  
Ramp Island Or Median None  
Ramp Orientation Diag  
Google Street View Link:

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.7816316,-118.08819724](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7816316,-118.08819724)

Street 1 Name GERTRUDE\_DR  
Stop Condition-Street 1 YieldSign  
Street 2 Name KENSINGTON\_RD  
Stop Condition-Street 2 NoControl

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                           | Data | Compliance | Description                   | Data   |
|------------|---------------------------------------|------|------------|-------------------------------|--------|
| N/A        | Ramp Length (in)                      | 83   | N/A        | Flare Type LT                 |        |
| Yes        | Ramp Width (in)                       | 48   |            |                               | Sloped |
| Yes        | Ramp Run Slope (%)                    | 7.7  | N/A        | Flare Slope LT (%)            | 5      |
| Yes        | Ramp Cross Slope (%)                  | 0.8  | N/A        | Flare Traversable LT          | No     |
| N/A        | Landing Present                       | Yes  | N/A        | Flare Type RT                 |        |
| N/A        | Landing Length (in)                   | 48   |            |                               | Sloped |
| Yes        | Landing Width (in)                    | 48   | N/A        | Flare Slope RT (%)            | 5.8    |
| No         | Landing Run Slope (%)                 | 3.7  | N/A        | Flare Traversable RT          | No     |
| Yes        | Landing Cross Slope (%)               | 0.7  | No         | DWS Provided                  | No     |
| N/A        | Landing Movement Obstructed?          | No   | N/A        | DWS Contrast                  | N/A    |
|            | Landing Movement Type                 | N/A  | N/A        | DWS Length (in)               | N/A    |
| N/A        | Landing Shared                        | No   | N/A        | DWS Full Width                | N/A    |
| N/A        | Clear Space                           | Yes  | N/A        | DWS Offset Left (in)          | N/A    |
| N/A        | Clear Space To Crosswalk (in)         | 48   | N/A        | DWS Offset Right (in)         | N/A    |
| N/A        | Marked Crosswalk 1                    | No   | N/A        | Marked Crosswalk 2            | No     |
|            | Crossing 1 Direction                  | S    |            | Crossing 2 Direction          | E      |
|            | Marked Crosswalk 1 Width (in)         | N/A  |            | Marked Crosswalk 2 Width (in) | N/A    |
| N/A        | Ramp Inside Crosswalk 1               | N/A  | Yes        | Ramp Inside Crosswalk 2       | N/A    |
|            | Crossing 1 Slope (%)                  | 4.7  |            | Crossing 2 Slope (%)          | 3.9    |
|            | Crossing 1 Cross Slope (%)            | 0.8  |            | Crossing 2 Cross Slope (%)    | 0.6    |
| No         | Gutter Ponding                        | Yes  | Yes        | Curb Slope                    | 1.9    |
| Yes        | Gutter Lip Height (in)                | 0    |            | Road Run Slope (%)            | 0.2    |
| Yes        | Gutter Run Slope (%)                  | 1.5  |            | Road Cross Slope (%)          | 1      |
| Yes        | Gutter Cross Slope (%)                | 0.7  |            |                               |        |
| Yes        | Overall Surface Condition: Acceptable |      | No         | Perp Joint Present            | No     |
|            | Cross Gutter Present?                 | Yes  |            | Spandrel Present?             | Yes    |
|            | Replace Cross Gutter?                 | No   |            | Replace Spandrel?             | No     |

