



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)




Main Street: LOS_ALAMITOS_BLV Cross Street: BRADBURY_RD Location: NE

ADA ID: RPRK211221112625 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 4

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

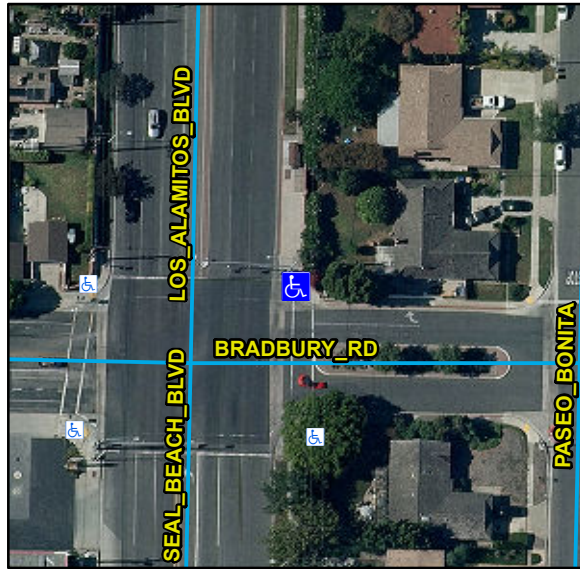

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.1, STD 1115

Total Cost: \$ 4000

Parcel ID Number **130-554-03**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78767668,-118.07177002

Street 1 Name **LOS_ALAMITOS_BLV**
Stop Condition-Street 1 **Signal**
Street 2 Name **BRADBURY_RD**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	103	N/A	Ramp Length RT (in)	73
Yes	Ramp Width LT (in)	93	Yes	Ramp Width RT (in)	62
Yes	Ramp Run Slope LT (%)	7.9	Yes	Ramp Run Slope RT (%)	7.4
Yes	Ramp Cross Slope LT (%)	1.3	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	62	Yes	DWS Contrast	Yes
No	Landing Width (in)	47	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.2	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.8		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	1
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	6.8		Crossing 2 Slope (%)	3.2
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	0
Yes	Gutter Ponding	No	Yes	Curb Slope	1.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
Yes	Gutter Run Slope (%)	2.5		Road Cross Slope (%)	1
Yes	Gutter Cross Slope (%)	0.8	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

