



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: CHRISTY_LN Cross Street: KEMPTON_DR Location: NE

ADA ID: RPRK211221125634 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 12

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

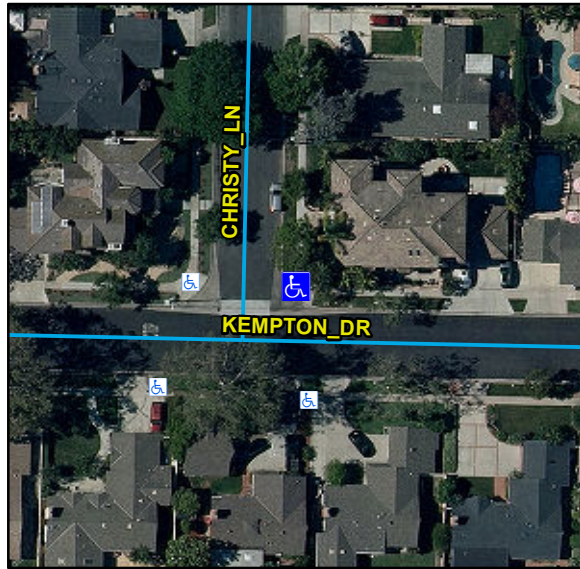

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2-Perp, R304.3.2-Para, R305, R302.7, R302.7.2, STD 1115

Total Cost: \$ 6310

Parcel ID Number **086-262-12**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

Street 1 Name **CHRISTY_LN**
Stop Condition-Street 1 **NoControl**
Street 2 Name **KEMPTON_DR**
Stop Condition-Street 2 **NoControl**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78555217,-118.08364555

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.5	N/A	Flare Slope LT (%)	5
Yes	Ramp Cross Slope (%)	1.2	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	49			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	3.2
No	Landing Run Slope (%)	2.1	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.3	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.3		Crossing 2 Slope (%)	3.4
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	0.1
No	Gutter Ponding	Yes	Yes	Curb Slope	3.1
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	0.6
Yes	Gutter Run Slope (%)	1.7		Road Cross Slope (%)	0.9
Yes	Gutter Cross Slope (%)	1			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

