



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **SPRING_ST** Cross Street: **N/A** Location: **NW**

ADA ID: **RPRK211223123956** Ramp Type: **Type 4 - Parallel** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

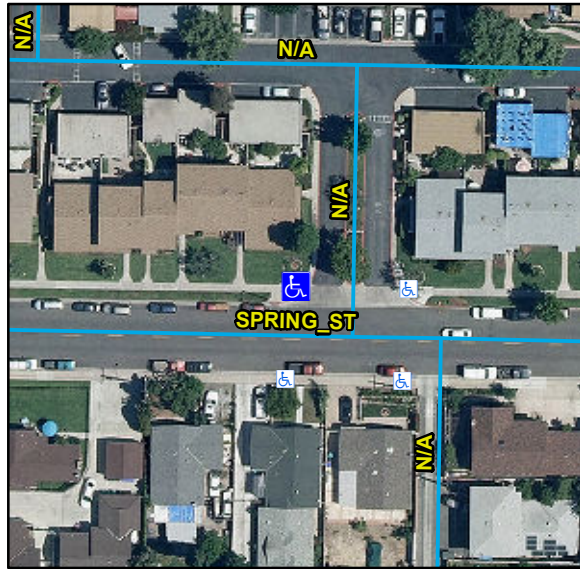

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, STD 1115

Total Cost: \$ **4000**

Parcel ID Number **383-062-84**

Ramp Island Or Median **None**

Ramp Orientation **Diag**

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7914554,-117.80218238

Street 1 Name **SPRING_ST**

Stop Condition-Street 1 **NoControl**

Street 2 Name **N/A**

Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	131	N/A	Ramp Length RT (in)	68
Yes	Ramp Width LT (in)	109	Yes	Ramp Width RT (in)	61
Yes	Ramp Run Slope LT (%)	3	Yes	Ramp Run Slope RT (%)	7.1
Yes	Ramp Cross Slope LT (%)	1.2	Yes	Ramp Cross Slope RT (%)	1.9
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	60	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	2	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	1
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.8		Crossing 2 Slope (%)	1.8
	Crossing 1 Cross Slope (%)	0.8		Crossing 2 Cross Slope (%)	0.8
Yes	Gutter Ponding	No	Yes	Curb Slope	6.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
Yes	Gutter Run Slope (%)	2		Road Cross Slope (%)	0.6
Yes	Gutter Cross Slope (%)	0.3	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

