




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CHAPMAN_AVE		Cross Street: RANCHO_SANTIAGO_BLVD		Location:	NW
ADA ID: RPRK211223125852	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

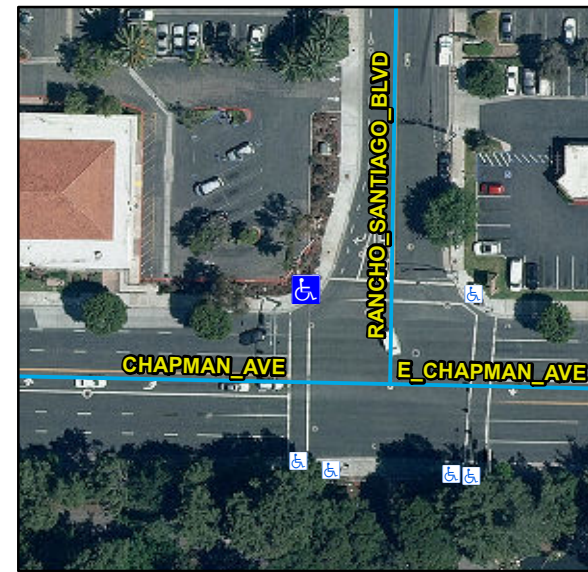

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, STD 1115


Total Cost: \$ 4000

Parcel ID Number	383-272-05	Street 1 Name	CHAPMAN_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	Diag	Street 2 Name	RANCHO_SANTIAGO_BLVD
Google Street View Link:		Stop Condition-Street 2	Signal

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78786737,-117.80149127

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Pull Box	

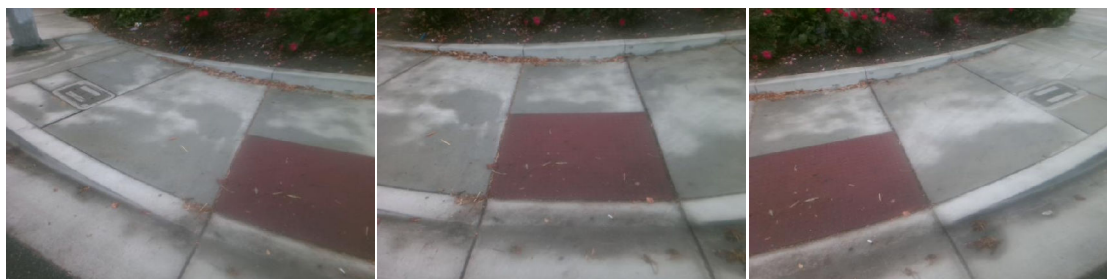

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	66	N/A	Ramp Length RT (in)	62
Yes	Ramp Width LT (in)	85	Yes	Ramp Width RT (in)	85
Yes	Ramp Run Slope LT (%)	2.8	Yes	Ramp Run Slope RT (%)	7.3
No	Ramp Cross Slope LT (%)	3.5	No	Ramp Cross Slope RT (%)	3.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	85	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	2.5	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	2.6		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	4.4		Crossing 2 Slope (%)	2.8
	Crossing 1 Cross Slope (%)	3.7		Crossing 2 Cross Slope (%)	0.9
Yes	Gutter Ponding	No	N/A	Curb Slope	3.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
Yes	Gutter Run Slope (%)	4.4		Road Cross Slope (%)	3.6
Yes	Gutter Cross Slope (%)	1.6	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A