



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: E_CHAPMAN_AVE Cross Street: HEWES_ST Location: NE

ADA ID: RPRK211223132536 Ramp Type: Type 1 - Perpendicular Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 2

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

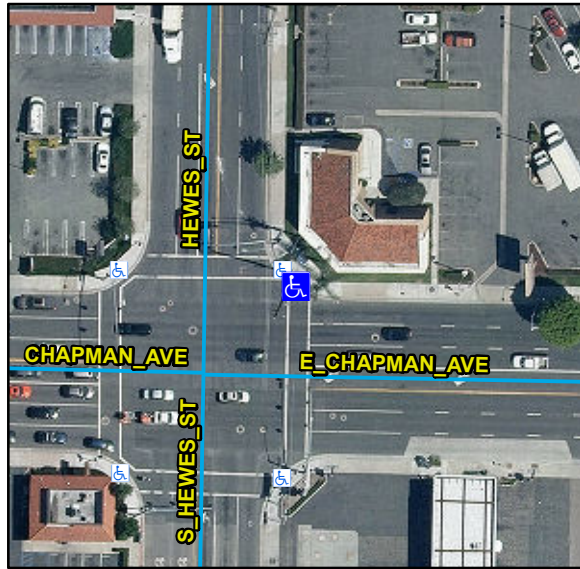

Possible Solutions:

Remove & Replace Landing. Gutter Ponding Observed. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.5.3, R302.7, STD 1115

Total Cost: \$ 783

Parcel ID Number 383-272-01
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78787199,-117.80555574

Street 1 Name E_CHAPMAN_AVE
Stop Condition-Street 1 Signal
Street 2 Name HEWES_ST
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Traffic Signal Pole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	85	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	48			
Yes	Ramp Run Slope (%)	7.2	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.9	N/A	Flare Traversable LT	N/A
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	54			Sloped
Yes	Landing Width (in)	48	Yes	Flare Slope RT (%)	7.2
Yes	Landing Run Slope (%)	1.8	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	2.1	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.7		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.5		Crossing 2 Cross Slope (%)	N/A
No	Gutter Ponding	Yes	Yes	Curb Slope	2.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	4.8		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

