




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street:** DARMEL\_PL      **Cross Street:** DARMEL\_PL      **Location:** NW

**ADA ID:** RPRK211229134734      **Ramp Type:** Type 4 - Parallel      **Initial Pass/Fail:** Pass      **Overall Compliance:** No      **Severity Score:** 0

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

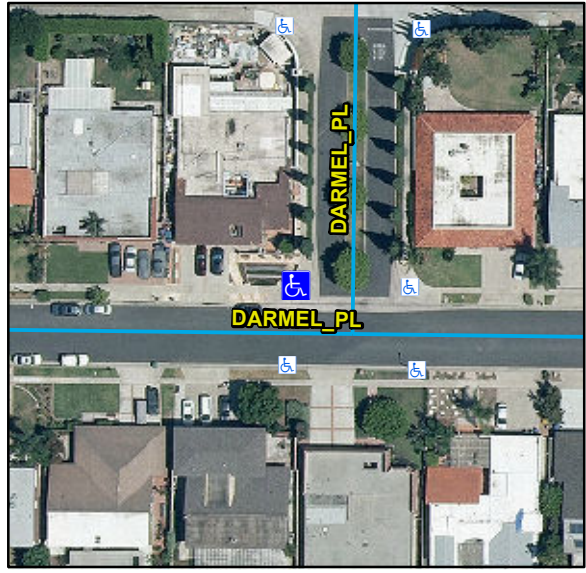

**Possible Solutions:**  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

**Surveyor Notes:**  
 N/A

**OC Std/PROW:**  
**R204.3, STD 1115**

**Total Cost:**      \$      **4000**

**Parcel ID Number:** 395-172-01  
**Ramp Island Or Median:** None  
**Ramp Orientation:** Diag  
**Google Street View Link:**  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.7729771,-117.81766755](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7729771,-117.81766755)

**Street 1 Name:** DARMEL\_PL  
**Stop Condition-Street 1:** NoControl  
**Street 2 Name:** DARMEL\_PL  
**Stop Condition-Street 2:** NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	112	N/A	Ramp Length RT (in)	114
Yes	Ramp Width LT (in)	92	Yes	Ramp Width RT (in)	92
Yes	Ramp Run Slope LT (%)	3.2	Yes	Ramp Run Slope RT (%)	5.6
Yes	Ramp Cross Slope LT (%)	1.4	Yes	Ramp Cross Slope RT (%)	1.8
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	92	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.8	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.8		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.2		Crossing 2 Slope (%)	1.1
	Crossing 1 Cross Slope (%)	0.6		Crossing 2 Cross Slope (%)	2
Yes	Gutter Ponding	No	Yes	Curb Slope	0.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.6
Yes	Gutter Run Slope (%)	1.4		Road Cross Slope (%)	1.3
Yes	Gutter Cross Slope (%)	0.8	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

