



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: RANCHWOOD_RD Cross Street: IRVINE_BLV Location: NW

ADA ID: RPRK220103125558 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

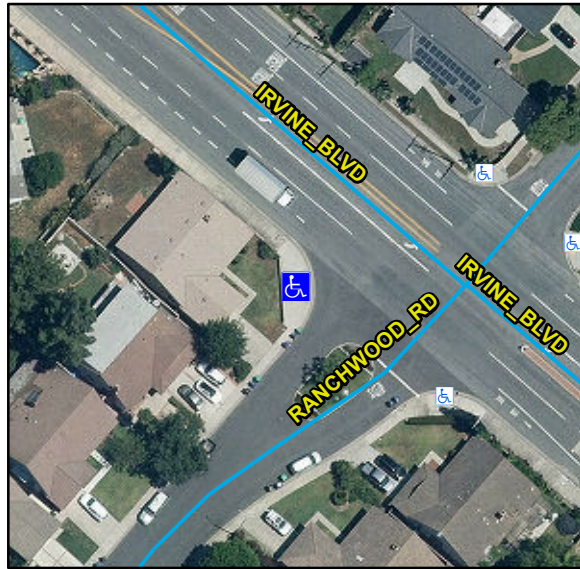

Possible Solutions:

Install Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305, R304.5.4, STD 1115

Total Cost: \$ 852

Parcel ID Number 500-013-32
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.73911259,-117.7965647

Street 1 Name RANCHWOOD_RD
Stop Condition-Street 1 StopSign
Street 2 Name IRVINE_BLV
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	117	N/A	Flare Type LT	
Yes	Ramp Width (in)	54			Sloped
Yes	Ramp Run Slope (%)	7.1	Yes	Flare Slope LT (%)	6.7
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	72			Sloped
Yes	Landing Width (in)	54	Yes	Flare Slope RT (%)	7.6
Yes	Landing Run Slope (%)	0.5	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.7	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Curb	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3		Crossing 2 Slope (%)	7.5
	Crossing 1 Cross Slope (%)	0.2		Crossing 2 Cross Slope (%)	1.8
Yes	Gutter Ponding	No	Yes	Curb Slope	3.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1
No	Gutter Run Slope (%)	8.3		Road Cross Slope (%)	2.1
Yes	Gutter Cross Slope (%)	0.5			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

